




ZE7 Block Diagram (Intel Cedar Trail-M Platform)

01

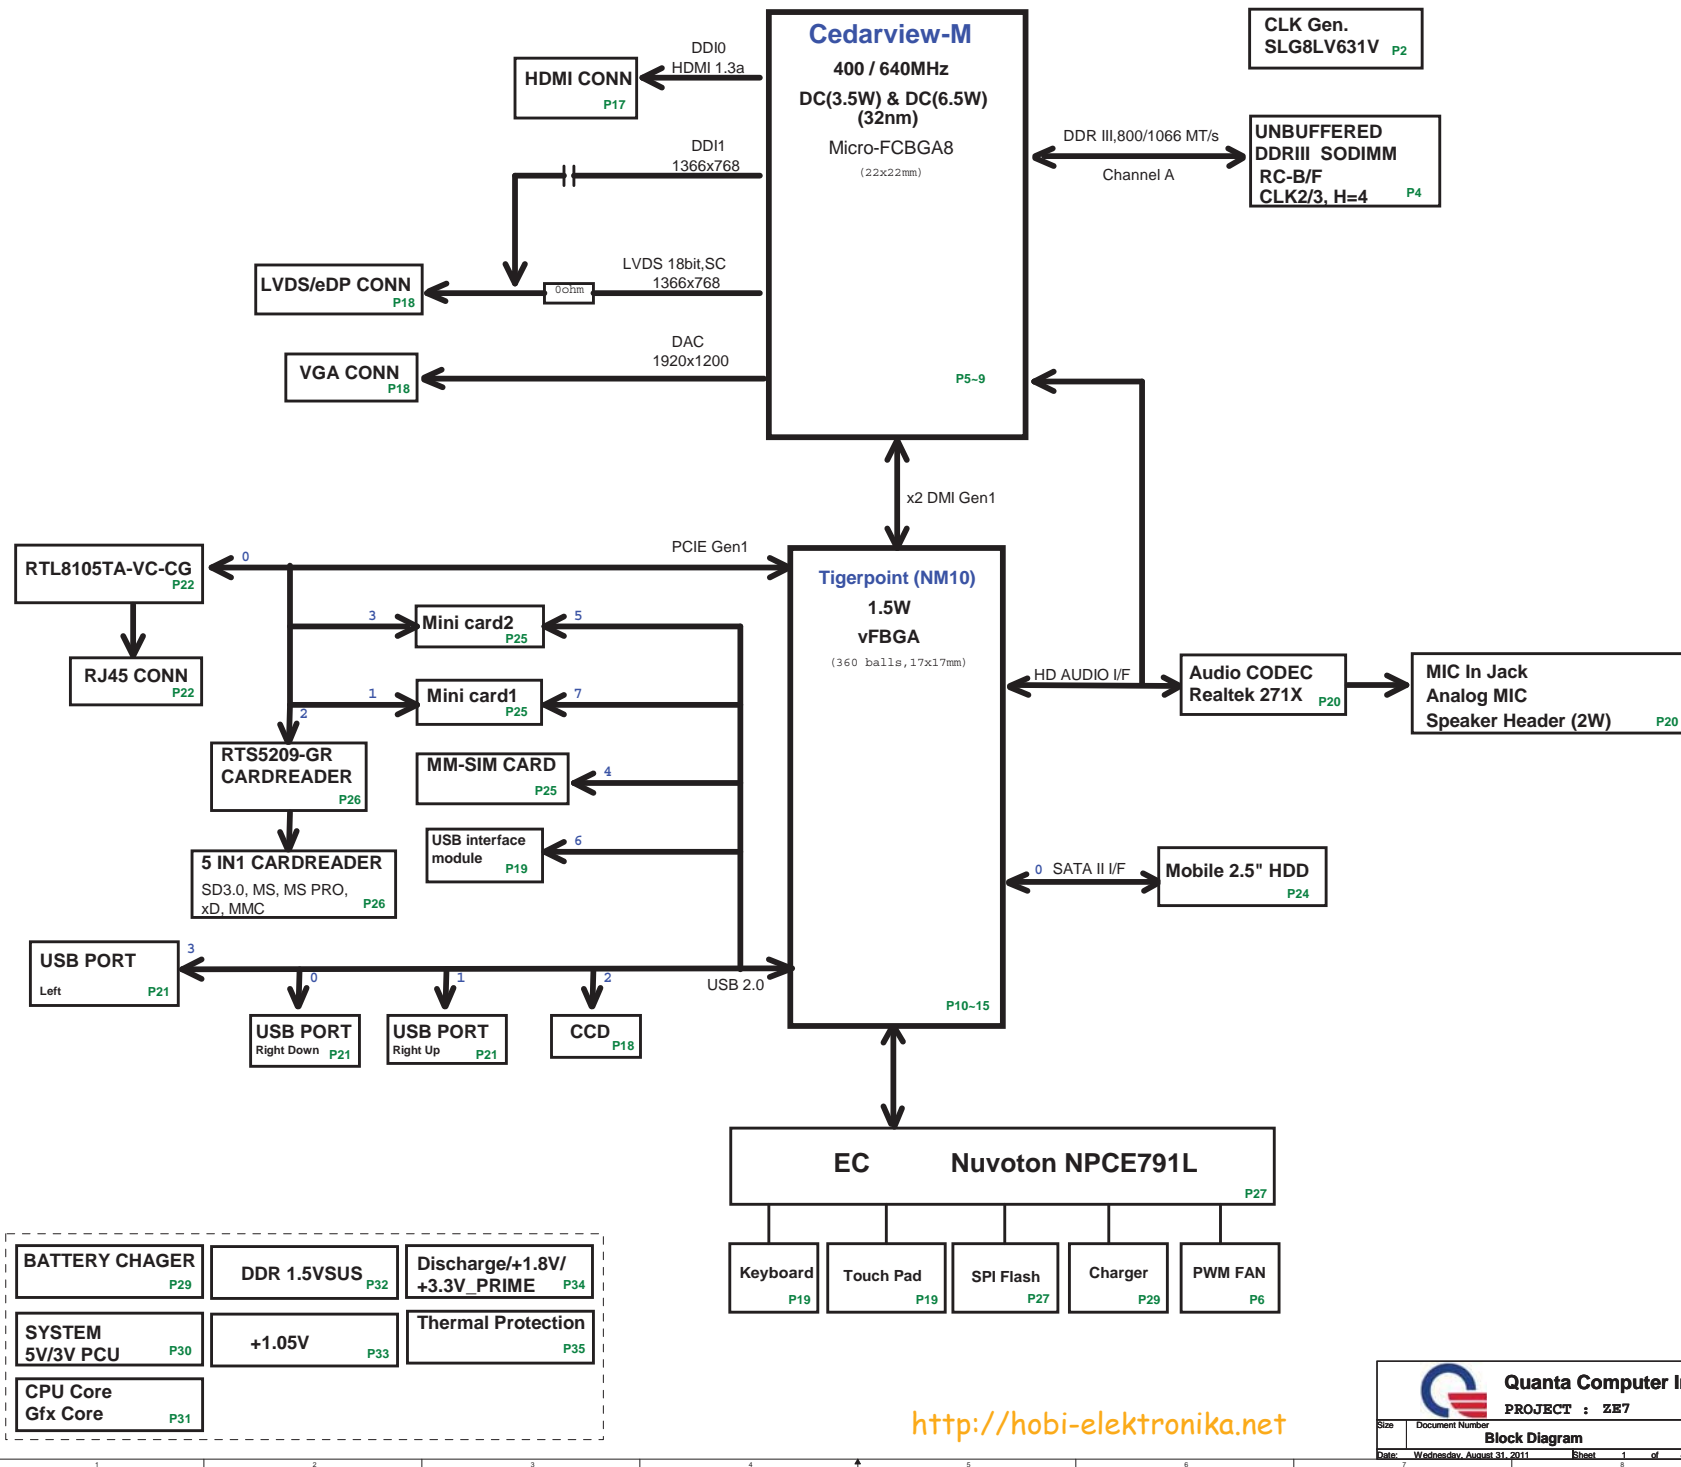



<http://hobi-elektronika.net>

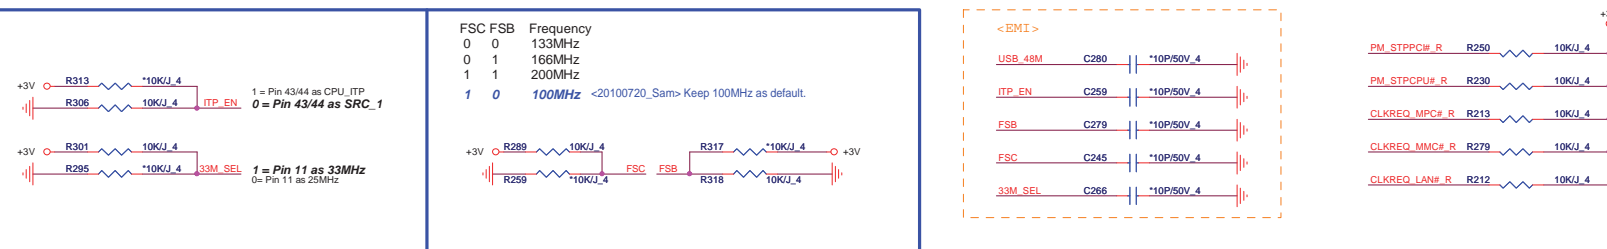


 <div style="display: inline-block; vertical-align: middle;"> Quanta Computer Inc. PROJECT : ZE7 </div>		
Size	Document Number	Rev C
CLOCK GENERATOR		
Date:	Wednesday, August 31, 2011	Sheet 2 of 42

Populate rules: populate SODIMM1 first
Strictly follow the mapping between clock/control signal groups and SODIMMs, as well as SMB address. Other configurations/mappings will not be supported by MRC


DESIGN NOTE:
ADDRESS-(A2)H

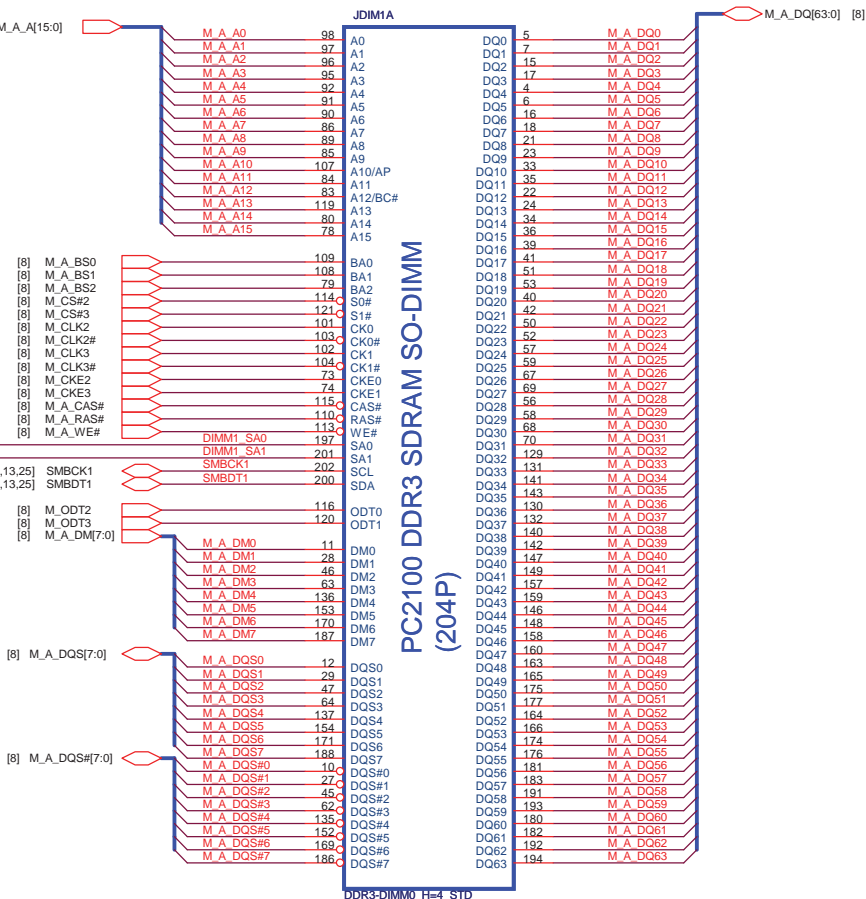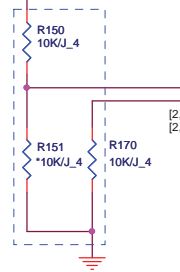


Place these Caps near DIMM0

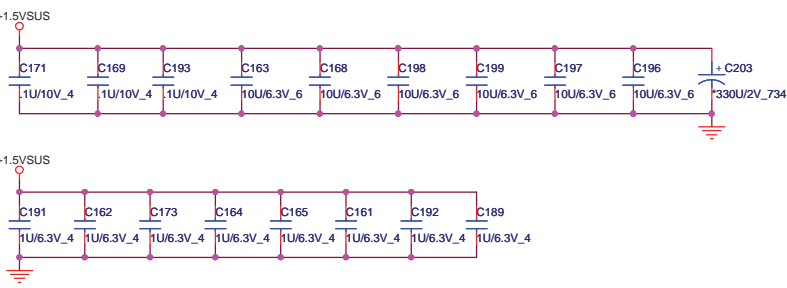


<20100827> Add by DG request

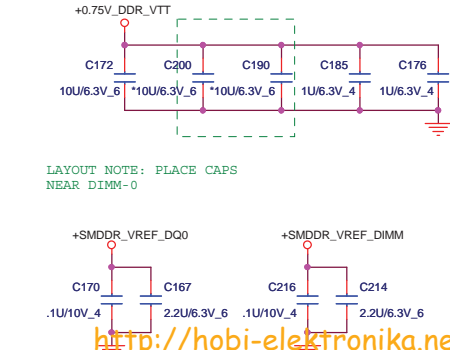


2.48A

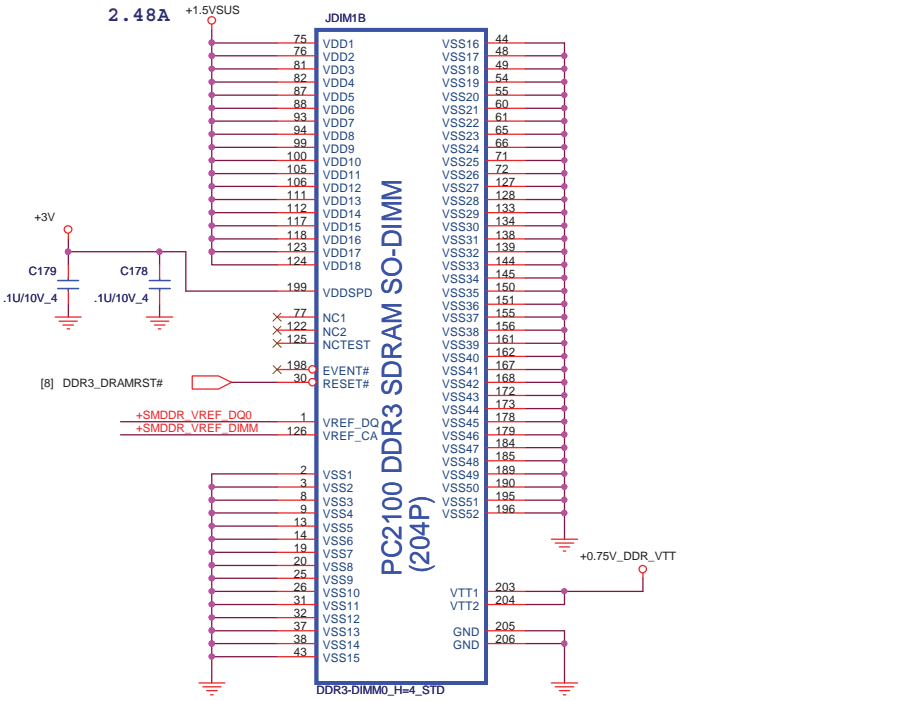

<Layout note>
PLACE TWO 1K RESISTORS CLOSE TO CPU DIMM ON
DDR_VREF_CA

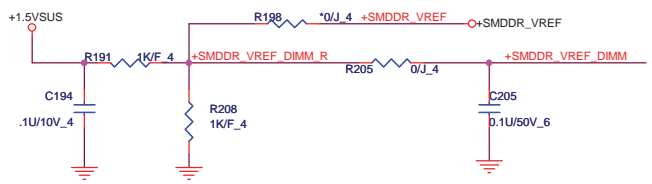

<Layout note>
PLACE TWO 1K RESISTORS CLOSE TO CPU DIMM ON
DDR_VREF_DQ




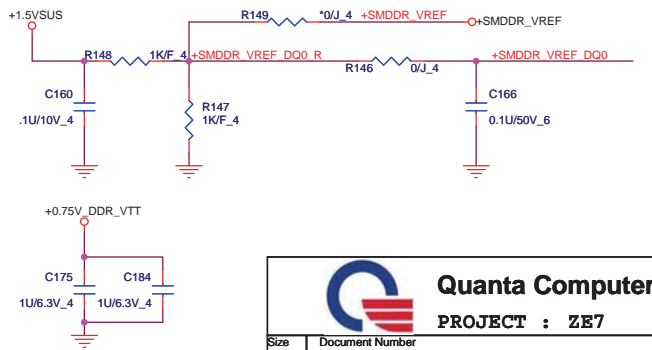


HDMI: 7.5", 4 via, 1.65 Gbps
Level Shifter For HDMI




eDP: 7", 3 via, 2.7Gbps

<20101125, Colts> Please follow PDG, we will doing BOM stuff changing in next version CRB


[13] ACZ_BITCLK_CPU
[13] ACZ_SYNC_CPU
[13] ACZ_SDINO
[13] ACZ_SDOU_CPU
[13] ACZ_RST#_CPU

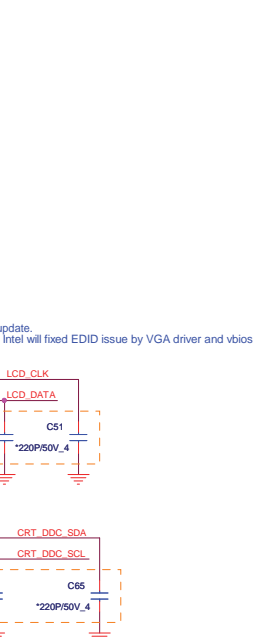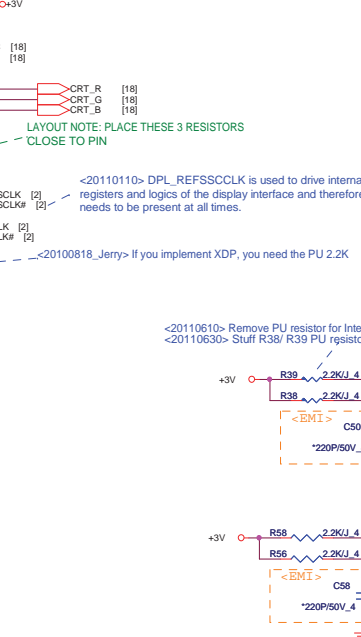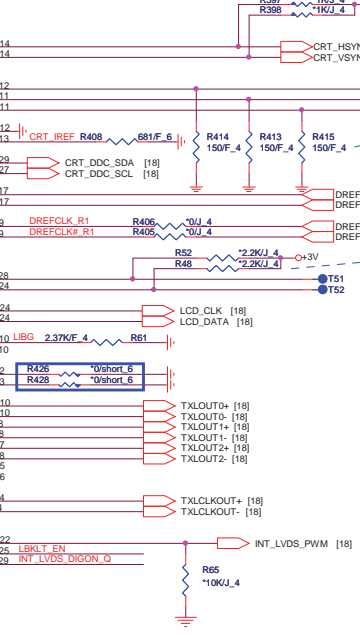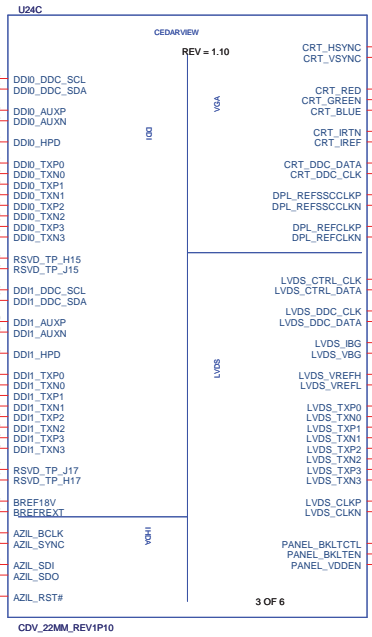


LCD Panel Power (LDS)

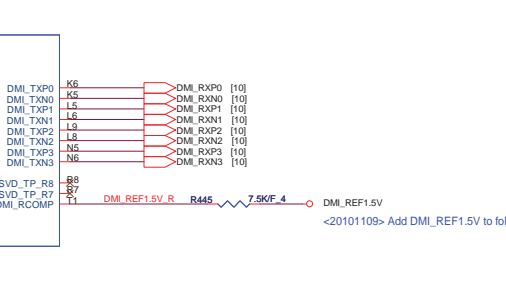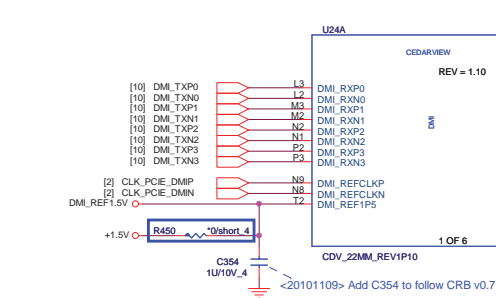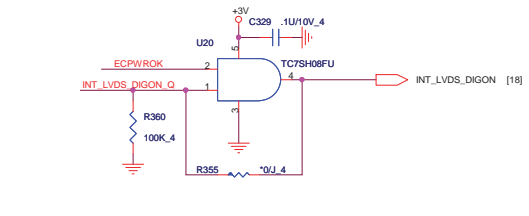

LCD Panel Backlight (LDS)

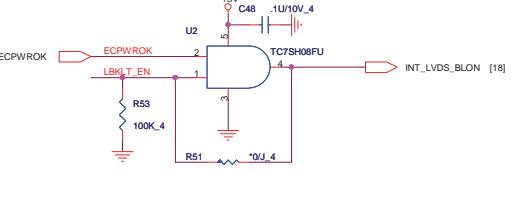


For HDMI deep color mode support (HDM)

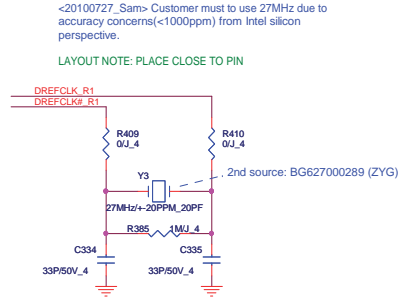

THERMAL SENSOR (THM)

<20110414> Unstuff Thermal Sensor and related circuit.

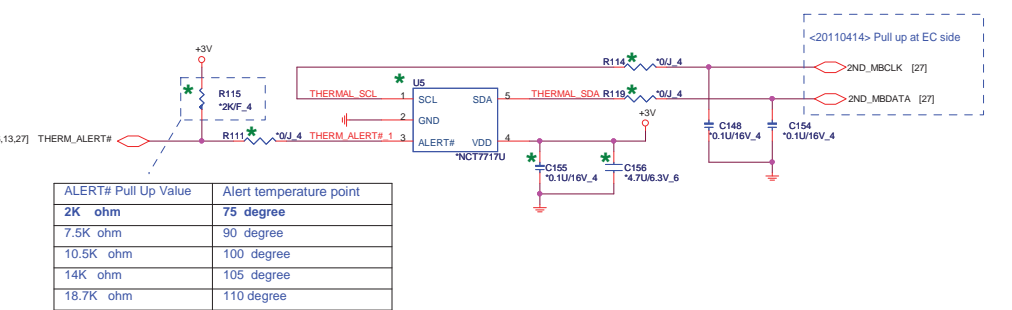

Alert# Pull Up Value	Alert temperature point
2K ohm	75 degree
7.5K ohm	90 degree
10.5K ohm	100 degree
14K ohm	105 degree
18.7K ohm	110 degree



For EMI

FAN_PWM_CN



FANSIG

C368
*220P/50V_6

C372
*220P/50V_6


<http://hobi-elektron>

Cedar View (CPU)

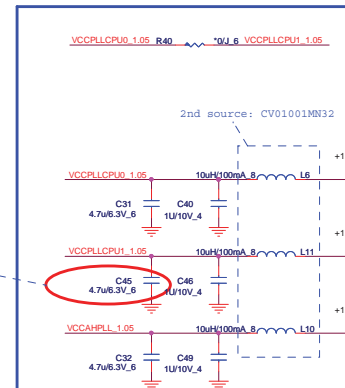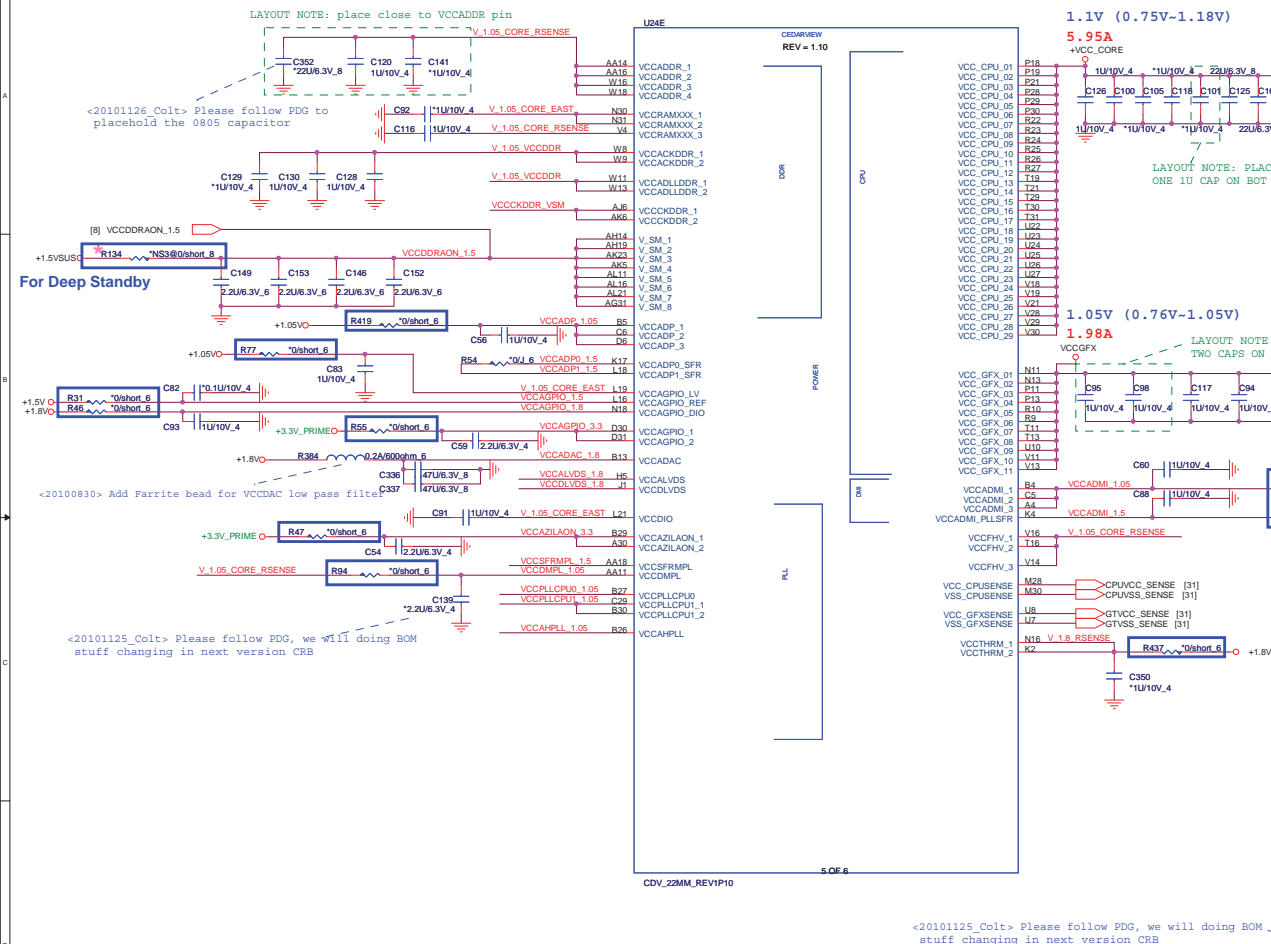

Cedar View PLL Power


Default stuff 1.5VPLL, Intel verify whether 1.05VPLL is ok or not

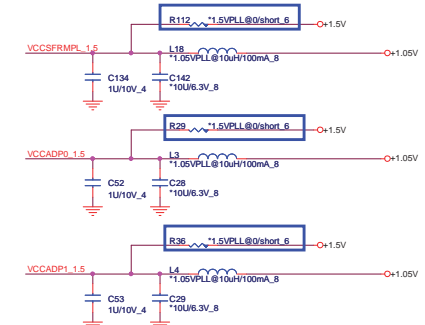


Cedar View LVDS Power

BOM structure

```
w/LVDS: stuff R436/ C345/ L38/ C75
w/EDP: unstuff R436/ C75
      change L38/ C345 to 0ohm
```

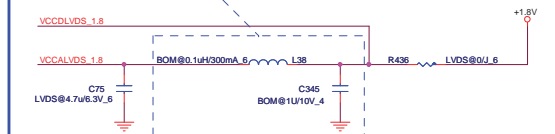

LAYOUT NOTE: OVERLAP RESISTOR AND INDUCTOR

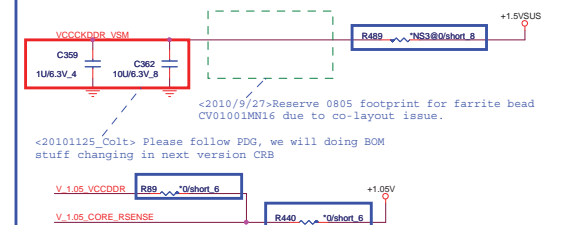

Quanta Computer Inc.


PROJECT : ZE7

Size	Document Number	Rev
	CedarView Power	C3C
Date:	Wednesday, August 31, 2011	Sheet 7 of 42

Cedar View (CPU)


08

<Layout note>
PLACE RESISTORS AND CAP CLOSE TO CPU DDR_VREF PIN


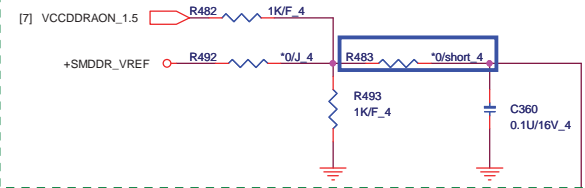


<20100810_Jerry> Please refer to Cedar Trail CPET HW section(#454349), it is to implement Deep Standby. And please waiting the whitepaper for implementation detail.

<20100817_Jerry> DELAY_VR_PWRGOOD on CDV should be connected to the XDP_PWRGOOD because the SV folks expressed a preference on using PWRGOOD over PWRGOOD for CDV. This has changed from PNV to CDV.

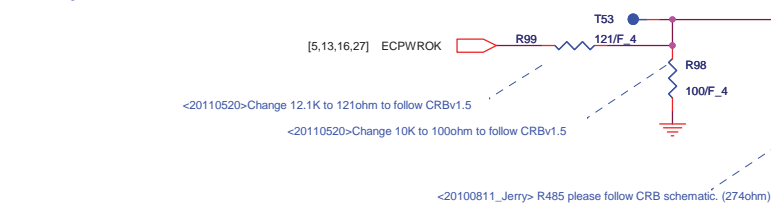


DRAM Reset (CPU)

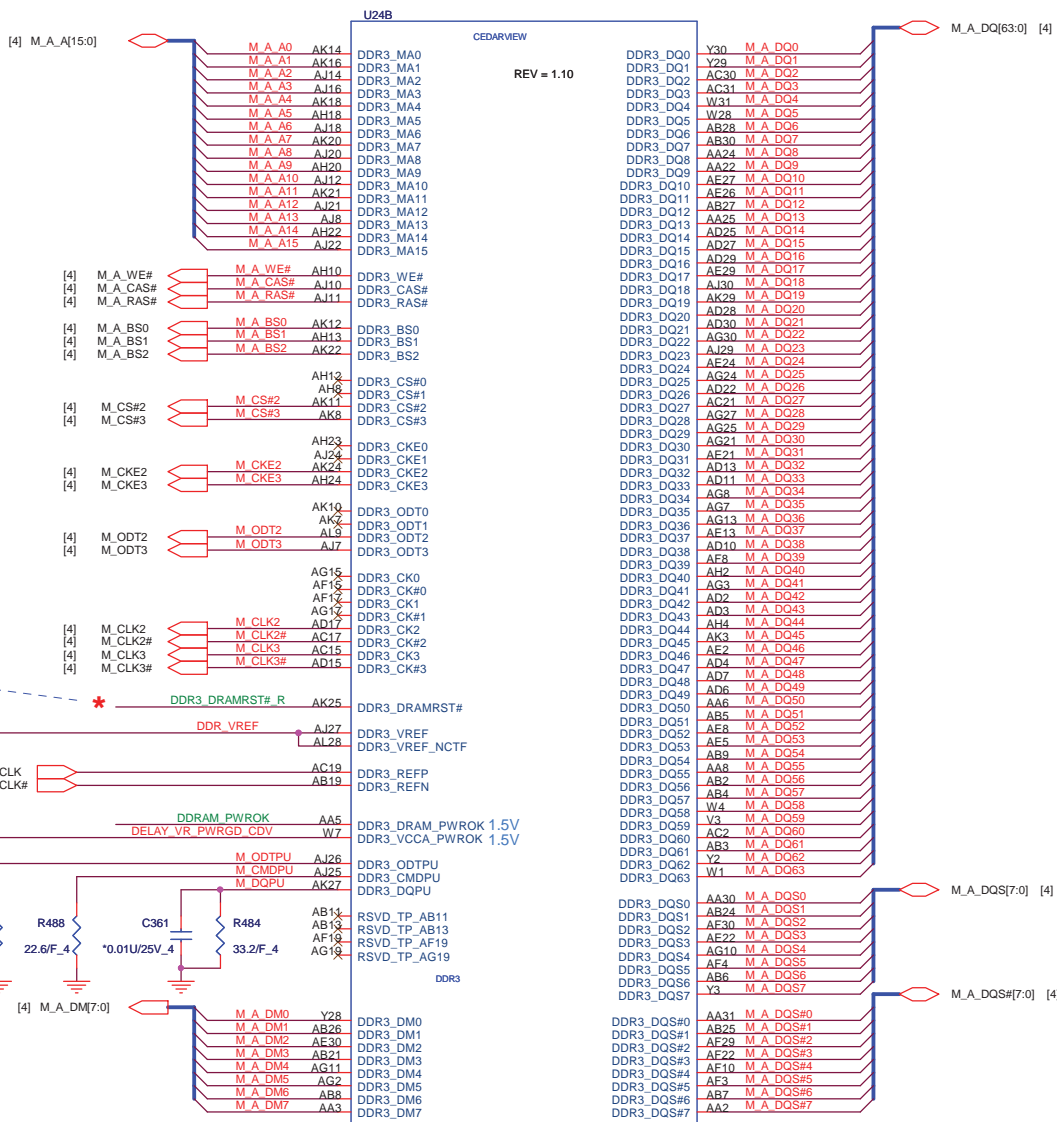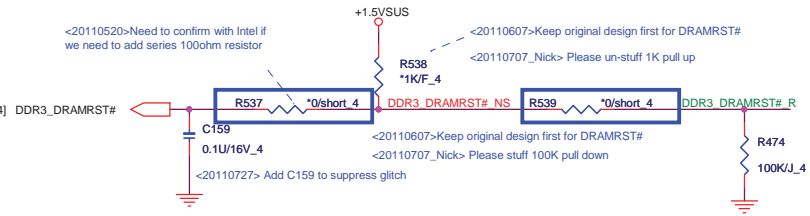


<http://hobi-elektronika.net>

Quanta Computer Inc.
PROJECT : ZE7

Size	Document Number	Rev
		C3C
Date:	Wednesday, August 31, 2011	Sheet 8 of 42

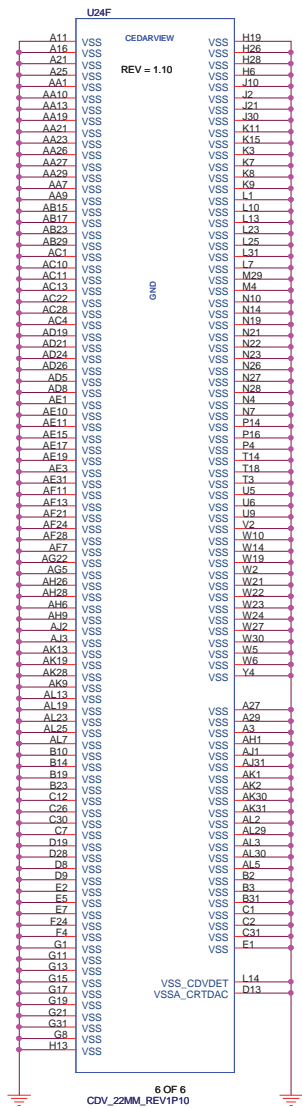



1. CPUSLP# is supported only on nettop platforms.



<20110607_C-stage> Stuff 1K to follow CRB V1.5




<http://hobi-elektronika.net>


Tiger Point (CLG)

12

PCI CLK 33M-Hz

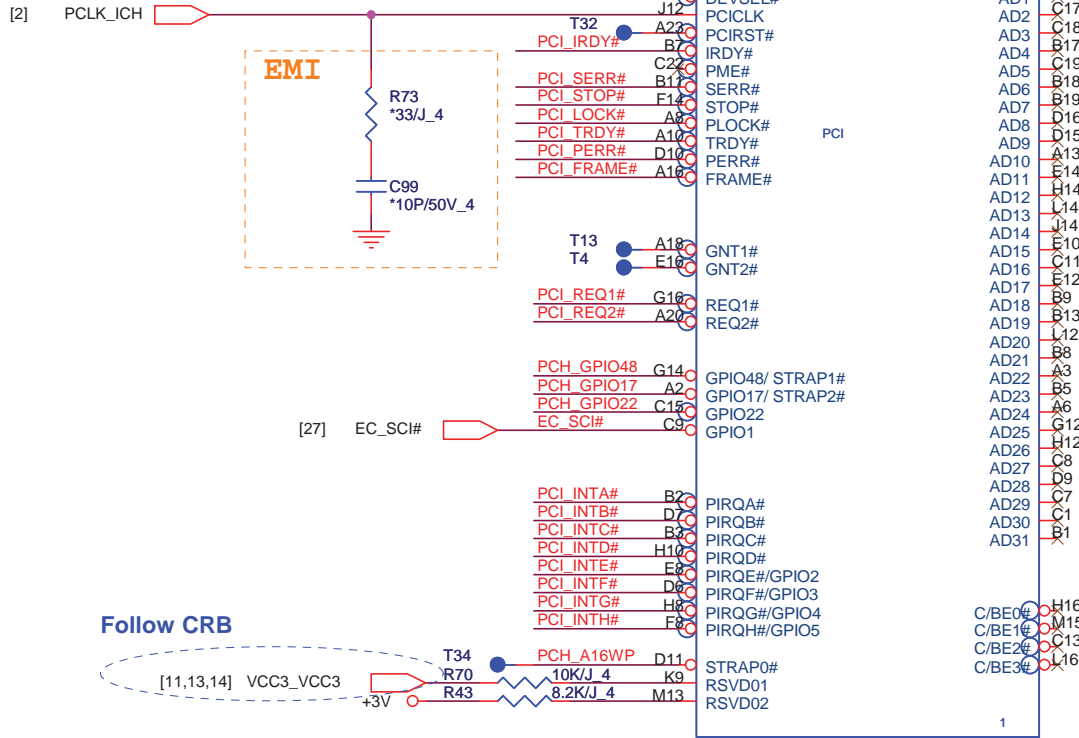

Follow CRB



<20090601(A1A)_Checklist Rev0.7>
Strap1#/strap2#: signals have weak internal pull-ups



ICH Boot BIOS select

PCH_GPIO17 (INT PU)	PCH_GPIO48 (INT PU)	Boot BIOS Location
0	1	SPI
1	0	PCI
1	1	LPC (CURRENTLY USE)

A16 SWAP Override strap


PCH_A16WP (INT PU)	Low = A16 swap override enabled High = Default
--------------------	---

PCI_GNT#2	Internal PU Should not be PD
-----------	---------------------------------

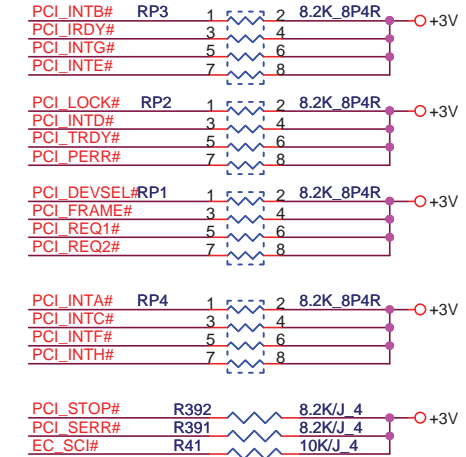


<20101104> Reserve R389(PCH_GPIO22 PD) for 27MHz or 96MHz choosing, need vBIOS support
Pull up --> for 27MHz
Pull down --> for 96MHz


IRQ	Description
PIRQA	USB UHCI Controller #1, #4
PIRQB	AC'97 Codec; option for SMBUS
PIRQC	USB UH Controller #3; SATA/IDE Native Mode
PIRQD	USB UHCI Controller #2
PIRQE	Internal LAN; Option for SCI, TCO, HPET#0,1,2
PIRQF	Option for SCI, TCO, HPET#0,1,2
PIRQG	Option for SCI, TCO, HPET#0,1,2
PIRQH	USB EHCI Controller; Option for SCI, TCO, HPET#0,1,2

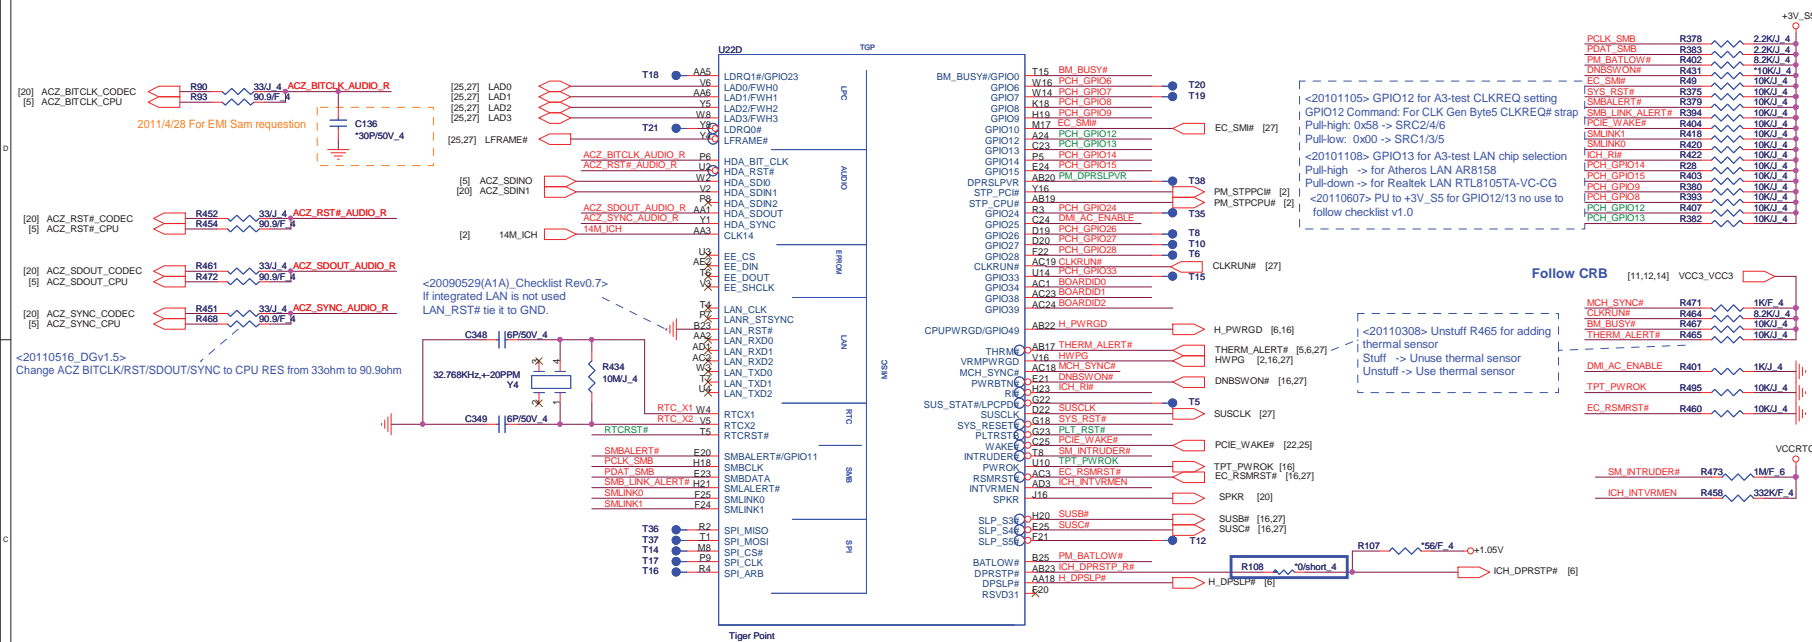


TPT Power OK (CLG)

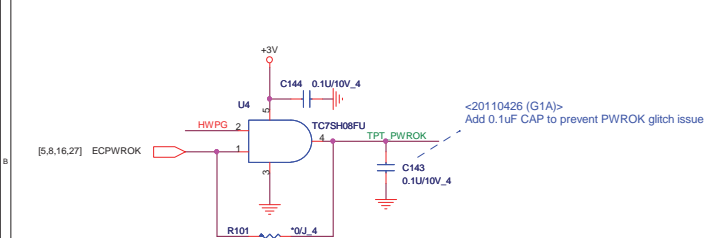


Platform Reset (CLG)

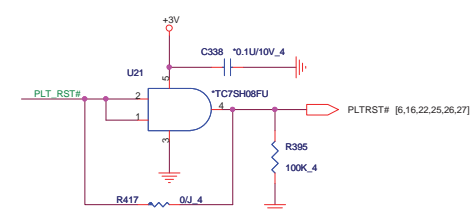


RTC (RTC)

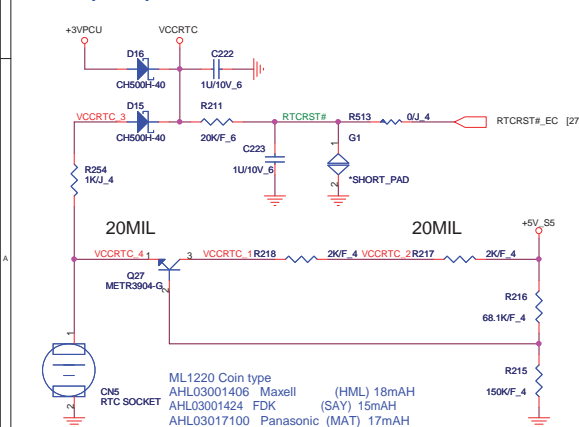

Clock GEN I2C Level Shift

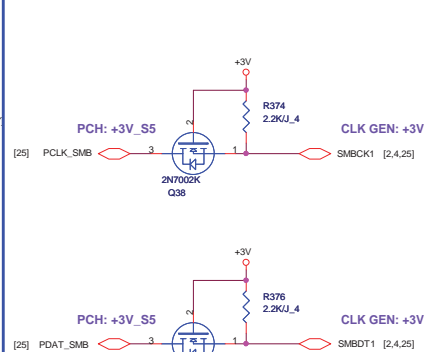


Mother Board ID (CLG)

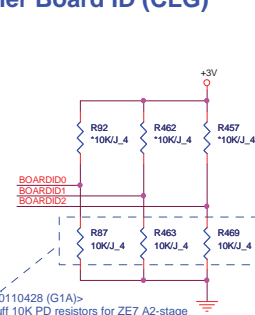



ACZ_SDOUT (INT PD)	ACZ_SYNC (INT PD)	Description
0	0	* 4 x 1s
1	0	Reserved
0	1	Reserved
1	1	1 x 4s(1 port/4 lanes)

INTVRMEN	
1	Enable internal VccSus1_5 VRM (default)
0	Disable

<Layout note>
Place 0402 caps close to ball
Place 0603/0805 caps close to ICH

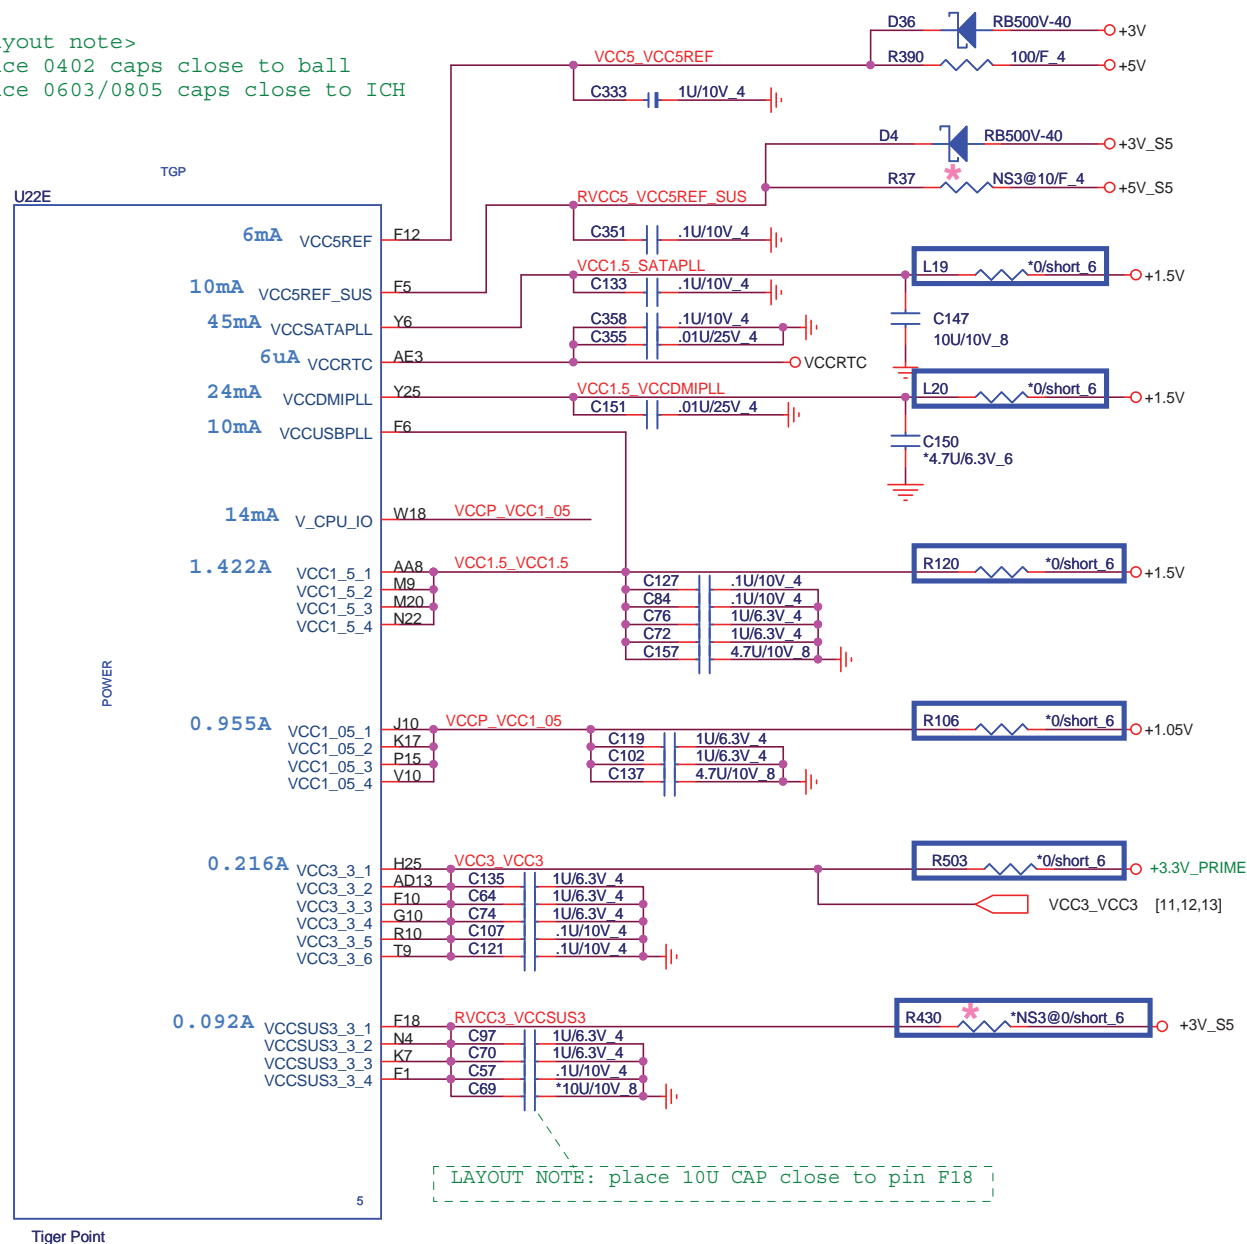

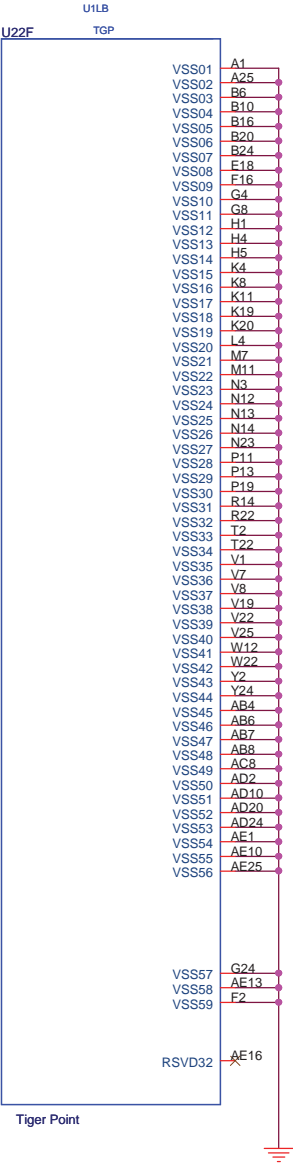





Quanta Computer Inc.

PROJECT : ZE7

Size	Document Number	Rev
TigerPoint GND		C3C
Date:	Wednesday, August 31, 2011	Sheet 15 of 42

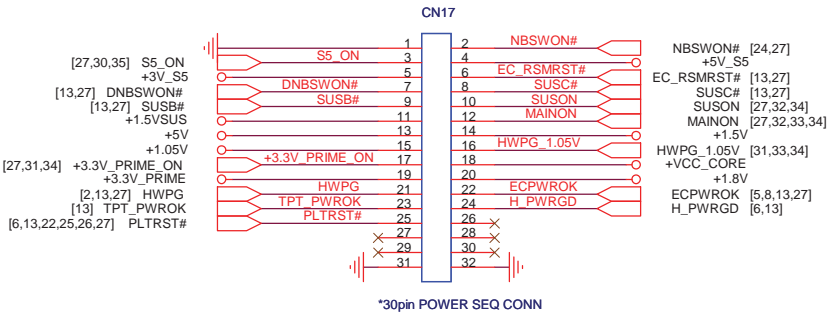



1	GND	11	+1.5VSUS	21	HWPG
2	NBSWON#	12	MAINON	22	ECPWROK
3	S5_ON	13	+5V	23	TPT_PWROK
4	+5V_S5	14	+1.5V	24	H_PWRGD
5	+3V_S5	15	+1.05V	25	PLTRST#
6	RSMRST#	16	HWPG_1.05V	26	RESERVE
7	DNBSWON#	17	VRON	27	RESERVE
8	SUSC#	18	+VCC_CORE	28	RESERVE
9	SUSB#	19	+3.3V_PRIME	29	RESERVE
10	SUSON	20	+1.8V	30	RESERVE



Quanta Computer Inc.


PROJECT : ZE7

Size	Document Number	Rev
	Cedarview XDP	C3C
Date:	Wednesday, August 31, 2011	Sheet 16 of 42

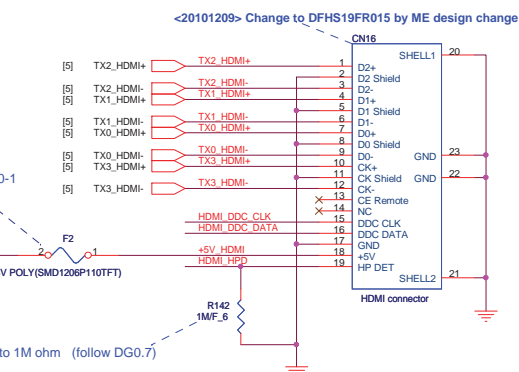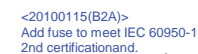


EMI reserve for HDMI (EMC)


Close to HDMI Connector

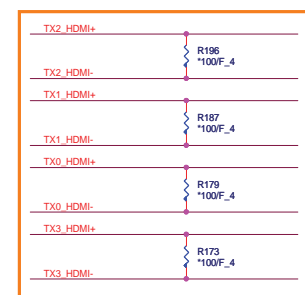


ESD Protect (HDM)


- Close to HDMI Connector

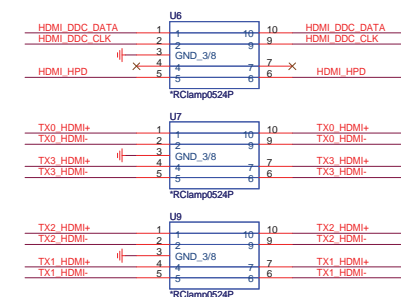


 Quanta Computer Inc. PROJECT : ZE7		Rev
Size	Document Number	C3C
HDMI		
Date	Wednesday, August 31, 2011	Sheet 17 of 42

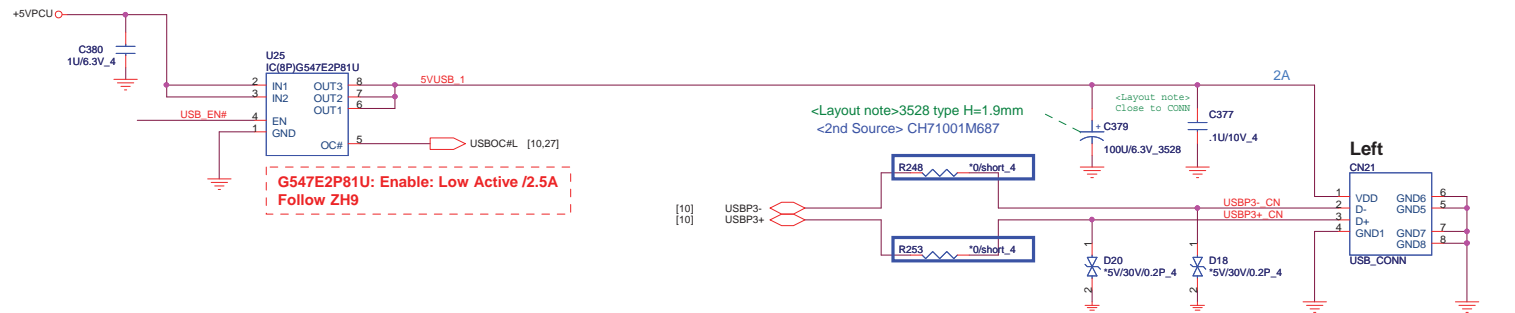

USB Right (USB)

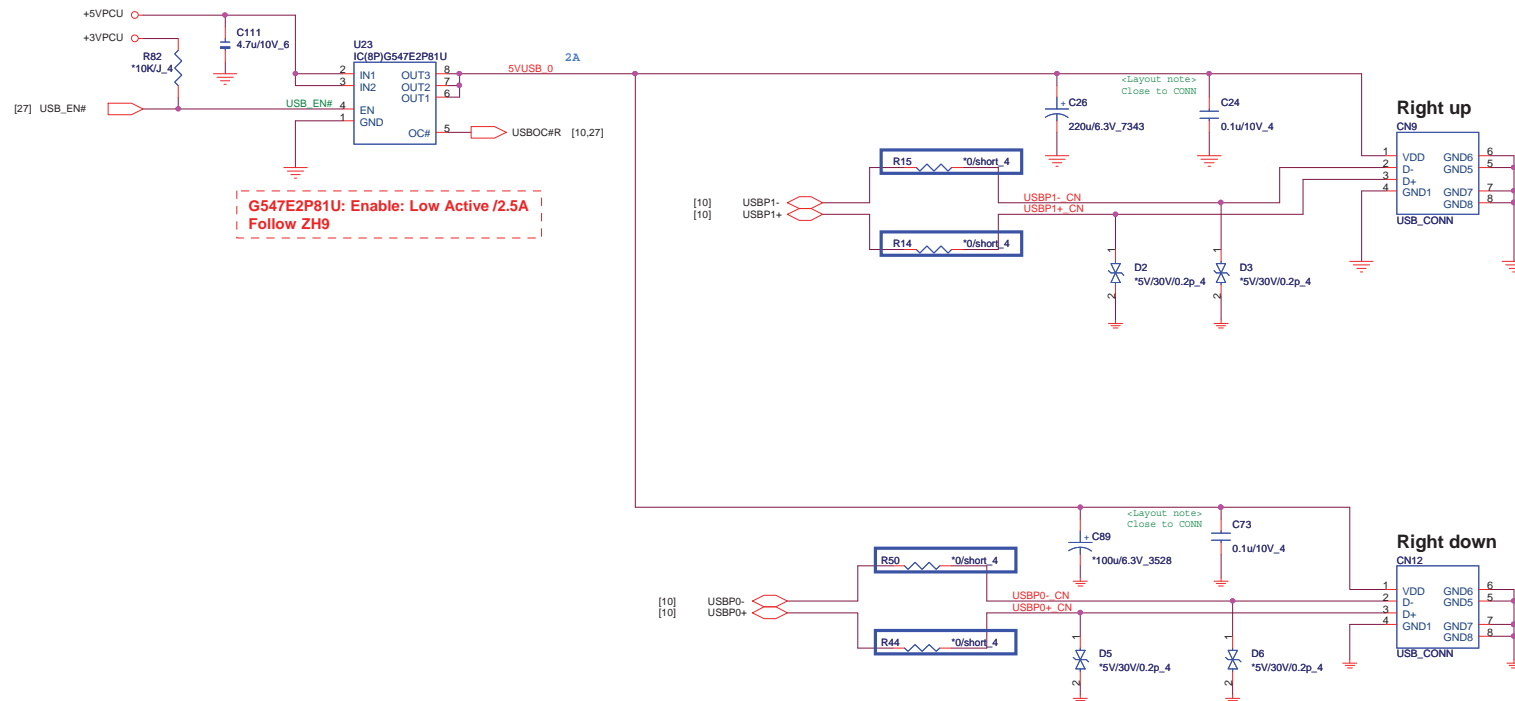


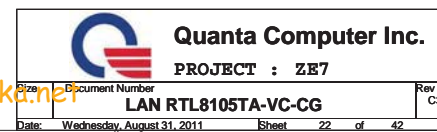


Stitching Capacitor (CLG)

23


For RF Request

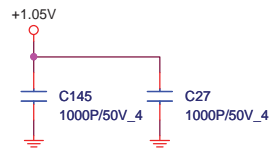


For CRT R/G/B Signals

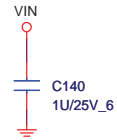


<http://hobi-elektronika.net>



		Quanta Computer Inc.	
		PROJECT : ZE7	
Size	Document Number	Rev	
Stitching Cap		C3C	
Date:	Wednesday, August 31, 2011	Sheet	23 of 42

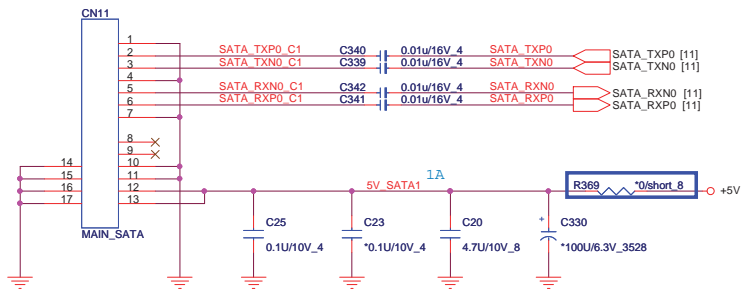



LED/SW (UIF)

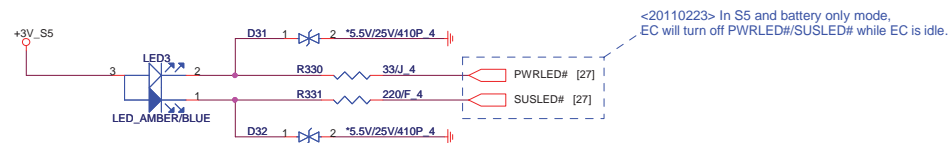PWR LED
SUS LED


PWR indicator

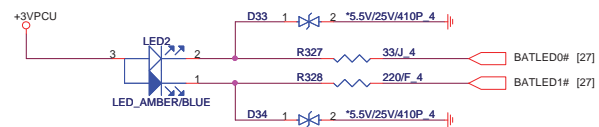FULL LED
CHG LED


PWR button

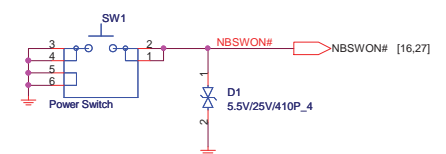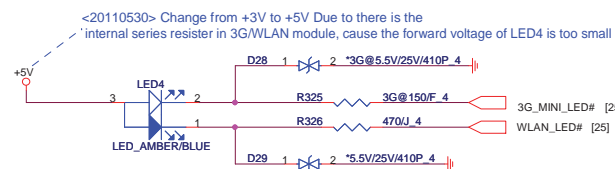3G LED
WLAN LED

HDD LED

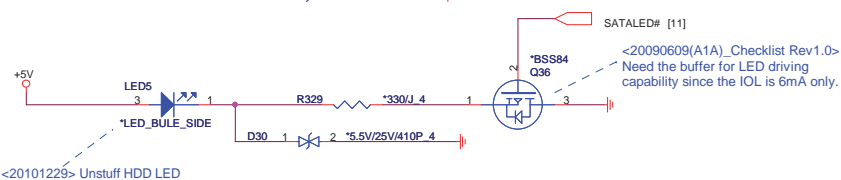

		Quanta Computer Inc.	
PROJECT : ZE7		Rev C3C	
Size	Document Number	SATA HDD/LED/SW	
Date:	Wednesday, August 31, 2011	Sheet	24 of 42

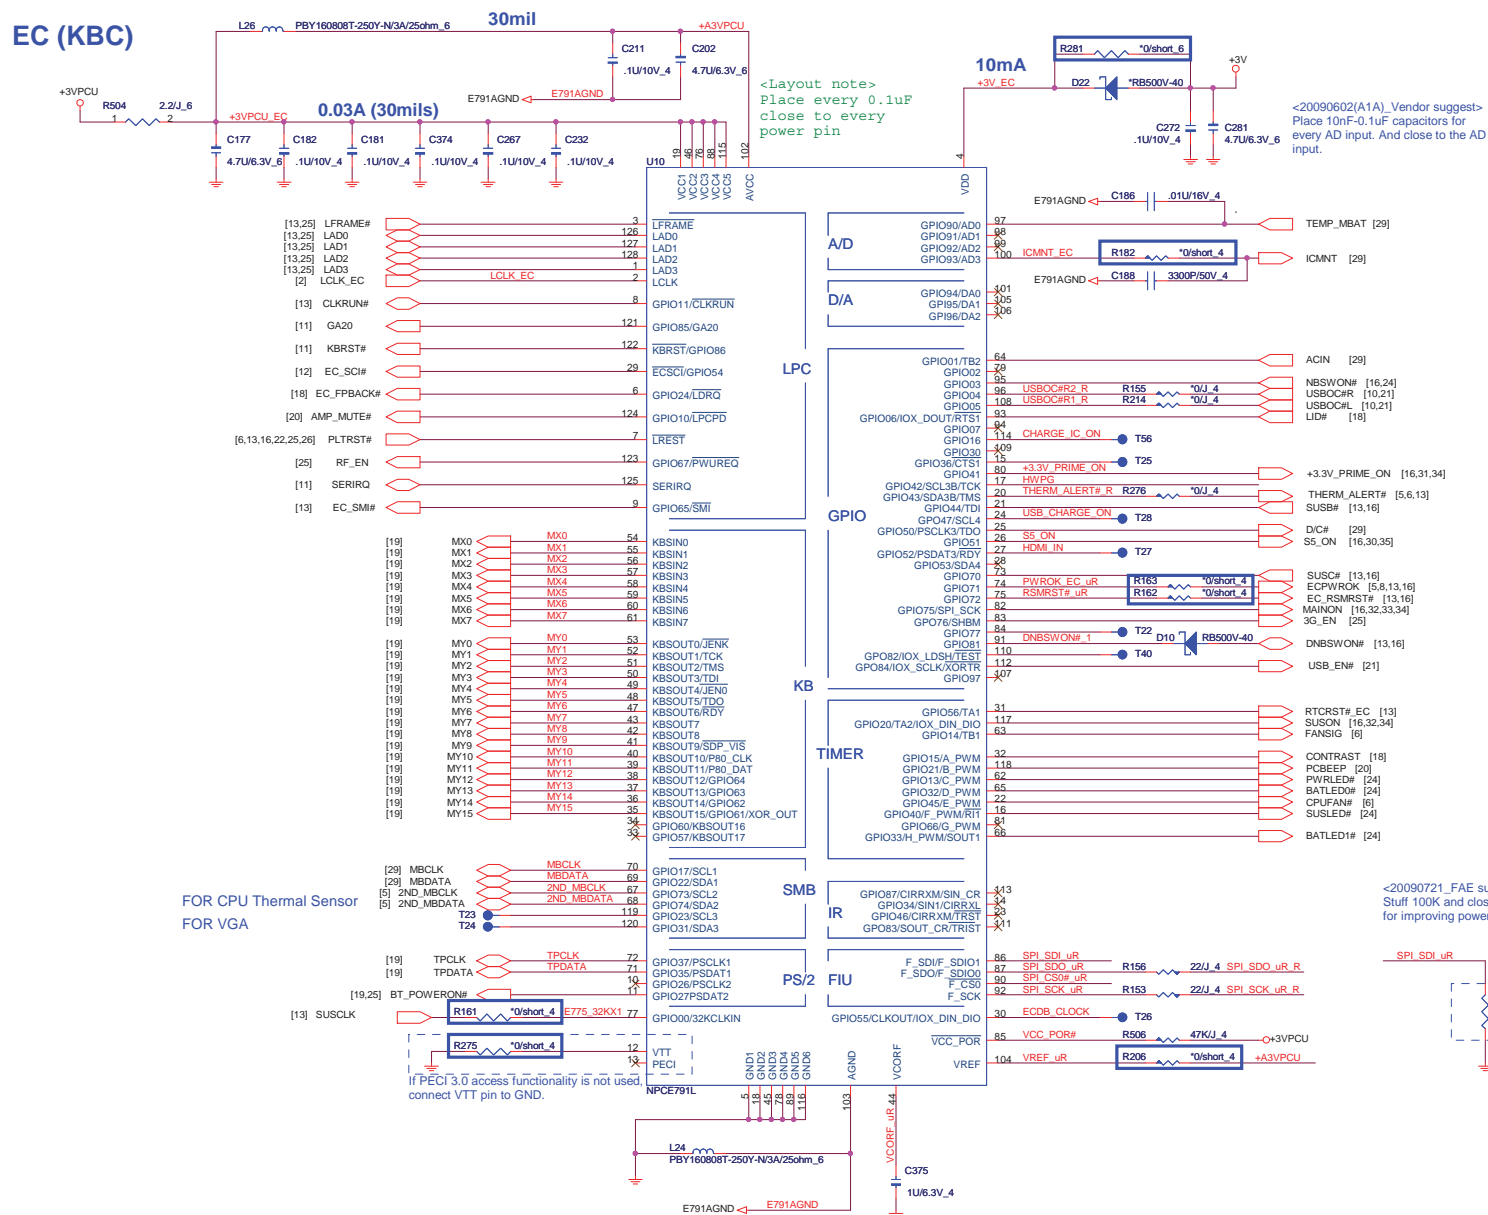

I/O ADDRESS SETTING(KBC)

SHBM=0: Enable shared memory with host BIOS




1/13 Confirm by vendor mail:

Disabled (*) if using FW device on LPC.

Enabled (0) if using SPI flash for both system BIOS and EC firmware

SM BUS PU(KBC)



- 1ST: Battery
2ND: CPU Thermal Sensor / DTS
3RD: VGA Thermal Sensor

<20090831(A1A)_EC team suggest>

1.change R166/R167 to 1M or 100K ohm


2.change PWR/SUS LED's power from +3VPCU to +3V_S5 or +3VSUS

can reduce pull-high resistor of SUSLED#/PWRLED#

SPI FLASH(KBC)

1/13 Confirm by vendor mail:

If the Southbridge enables 'Long Wait Abort' by default, the flash device should be 50MHz (or faster)


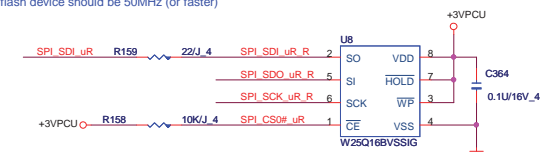


ZS9 A1~A3-test	W25Q16BVSSIG	AKE38FP0N01	16M bit
ZS9 A4-test	W25Q16CVSSIG	AKE38ZP0N02	16M bit
ZS9 A5-test	MX25L1606EM2I-12G	AKE38FP0Z01	16M bit
ZS9 A6-test	MX25L1606EM2I-12G	AKE38FP0Z01	16M bit
ZS9 A7-test	W25Q16BVSSIG	AKE38FP0N01	16M bit


Winbond	W25Q16BVSSIG	AKE38FP0N01
EON	EN25F16-75HCP	AKE38ZAOQ00
MXIC	MX25L1606EM2I-12G	AKE38FP0Z01 (Z6 MAC ID fail)

INTERNAL KEYBOARD STRIP SET (KBC)

HWPG (KBC)

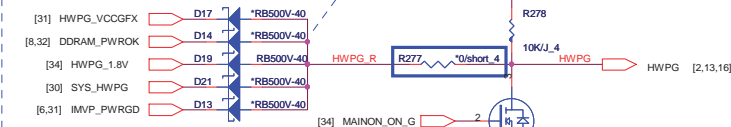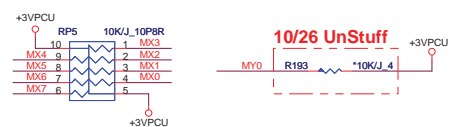
<http://hobielektronika.net>


<EMI>




HOLE (OTH)

28


TOP(HDD Hole)

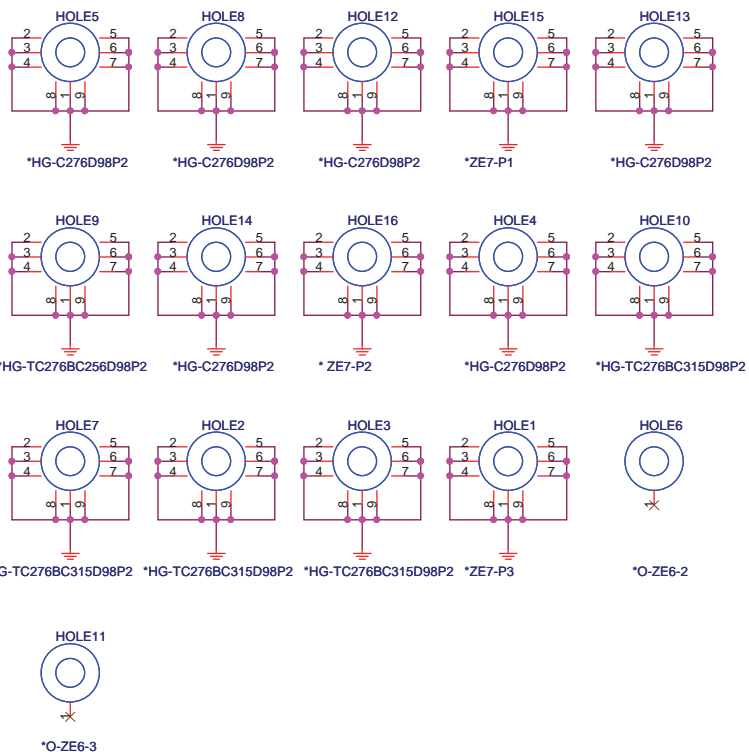

BOT(Thermal Hole)

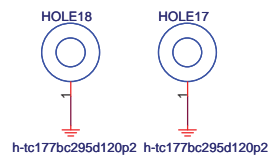

BOT(Mini-PCle Hole)

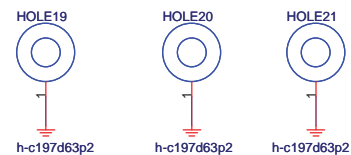

LED ESD PAD



TP ESD PAD





Quanta Computer Inc.

PROJECT : ZE7

Size	Document Number	Rev
	EMI/Hole	C3C
Date:	Wednesday, August 31, 2011	Sheet 28 of 42



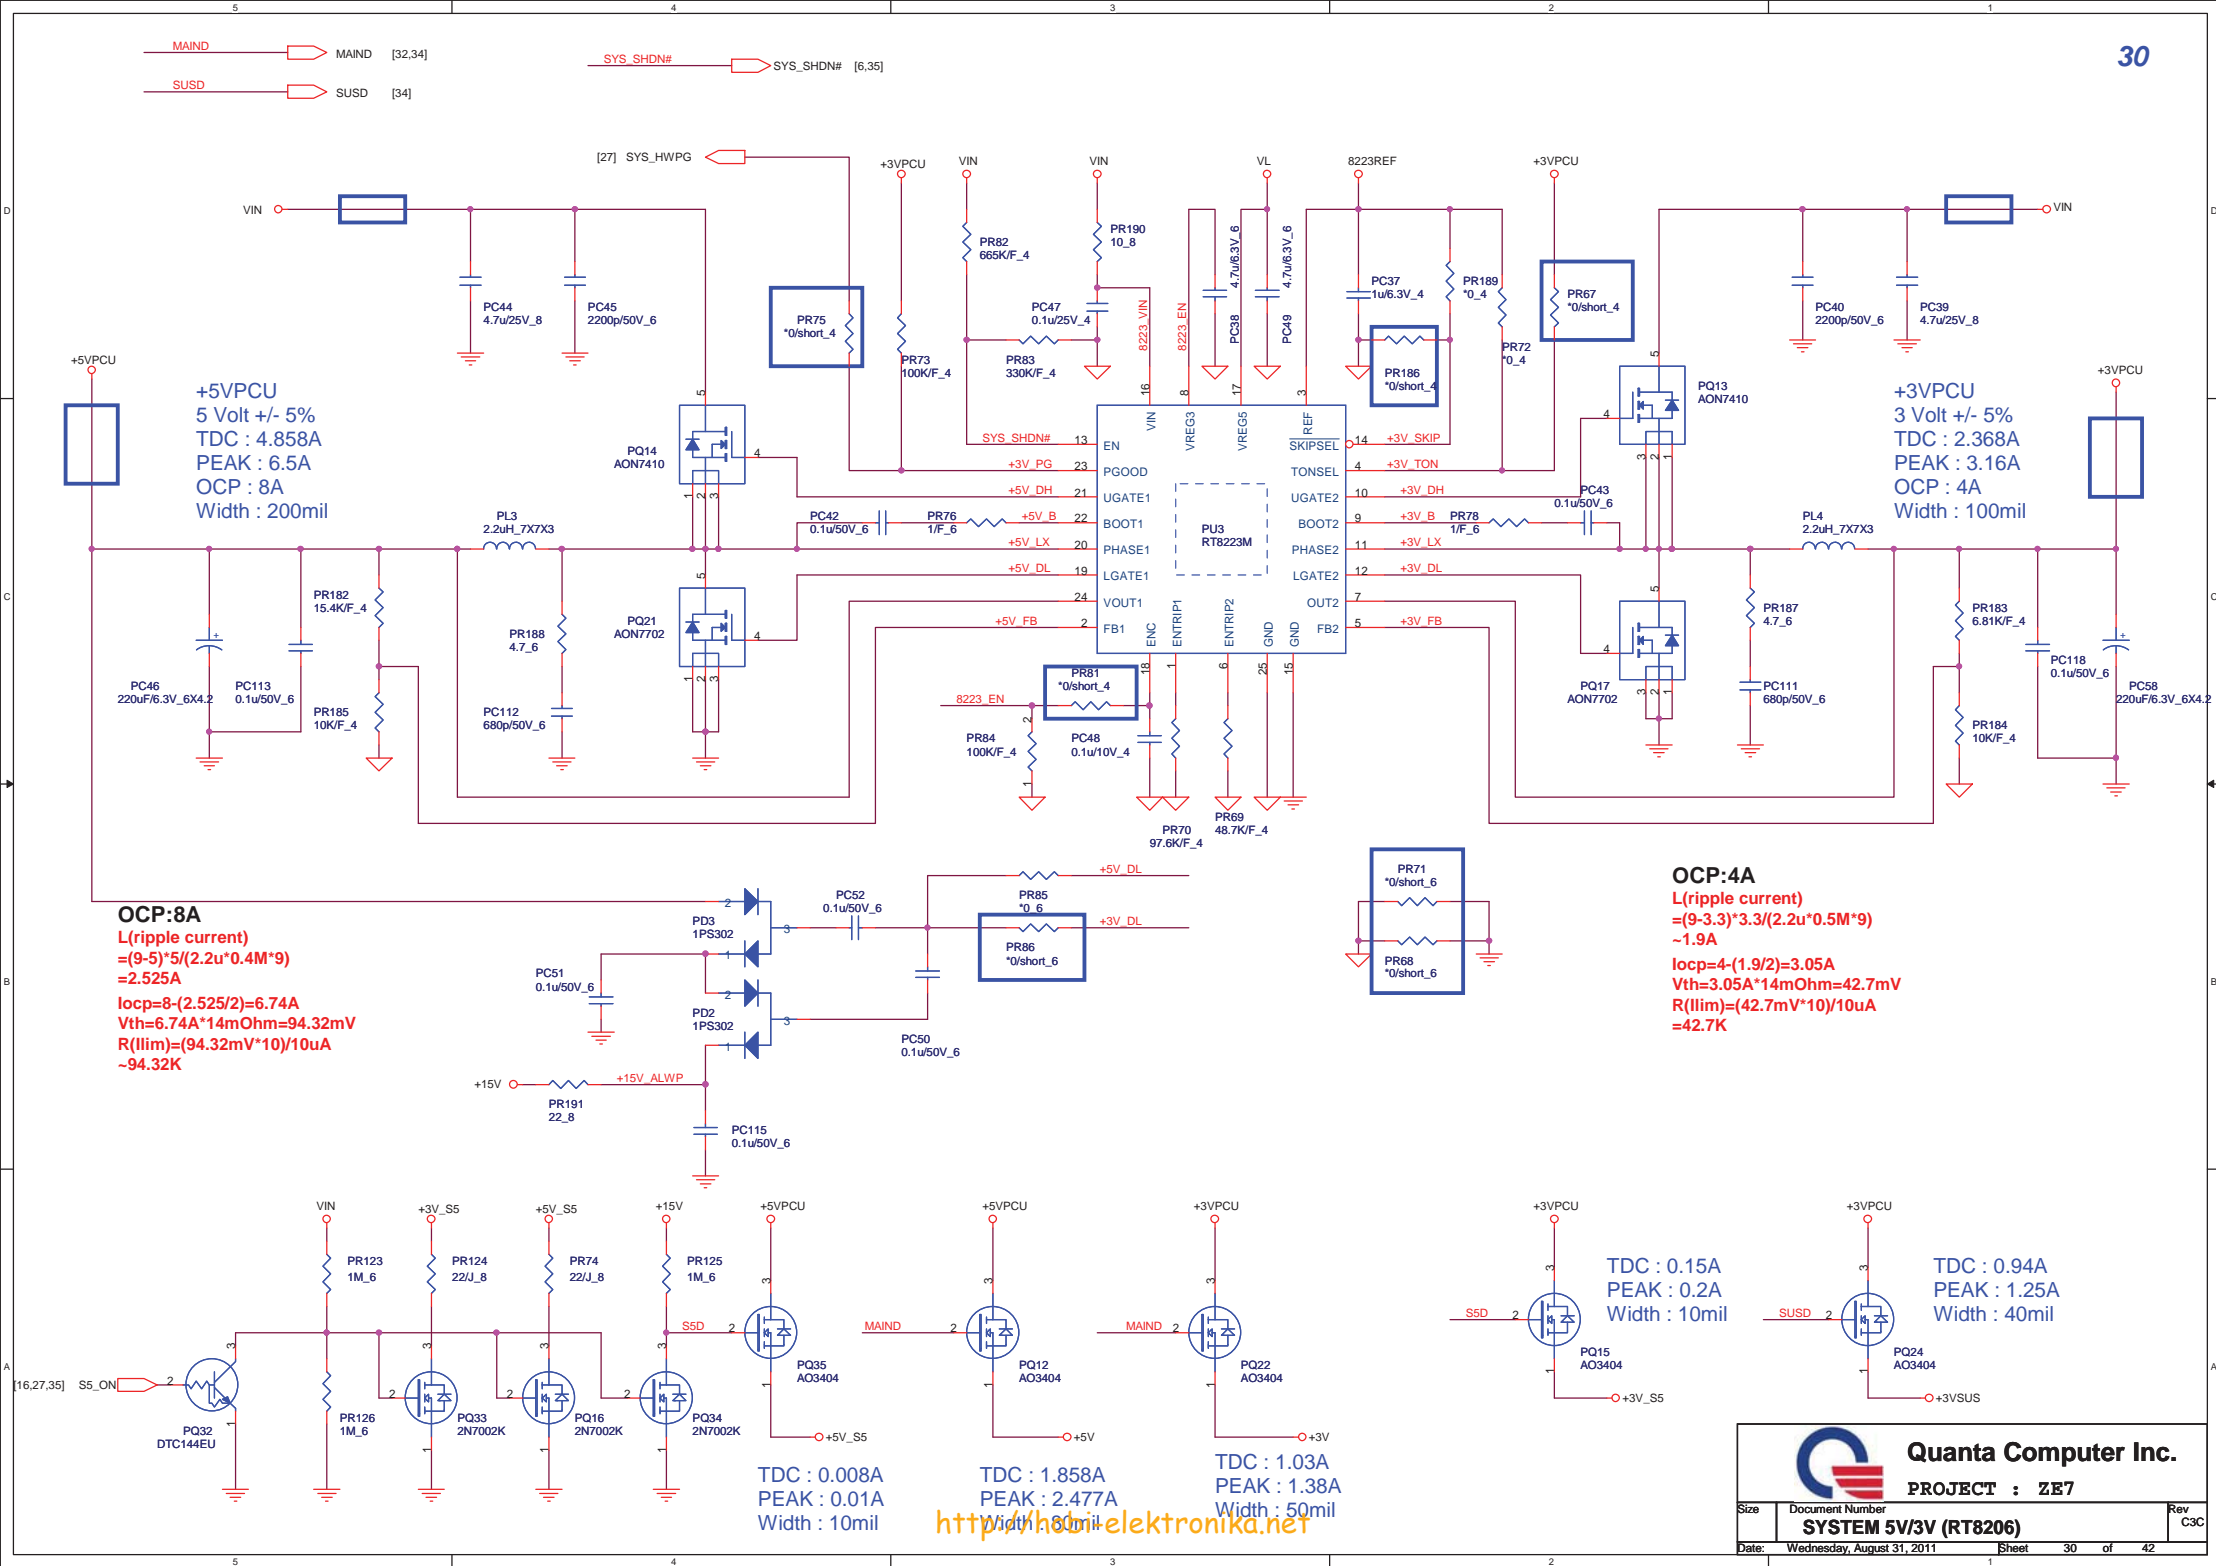


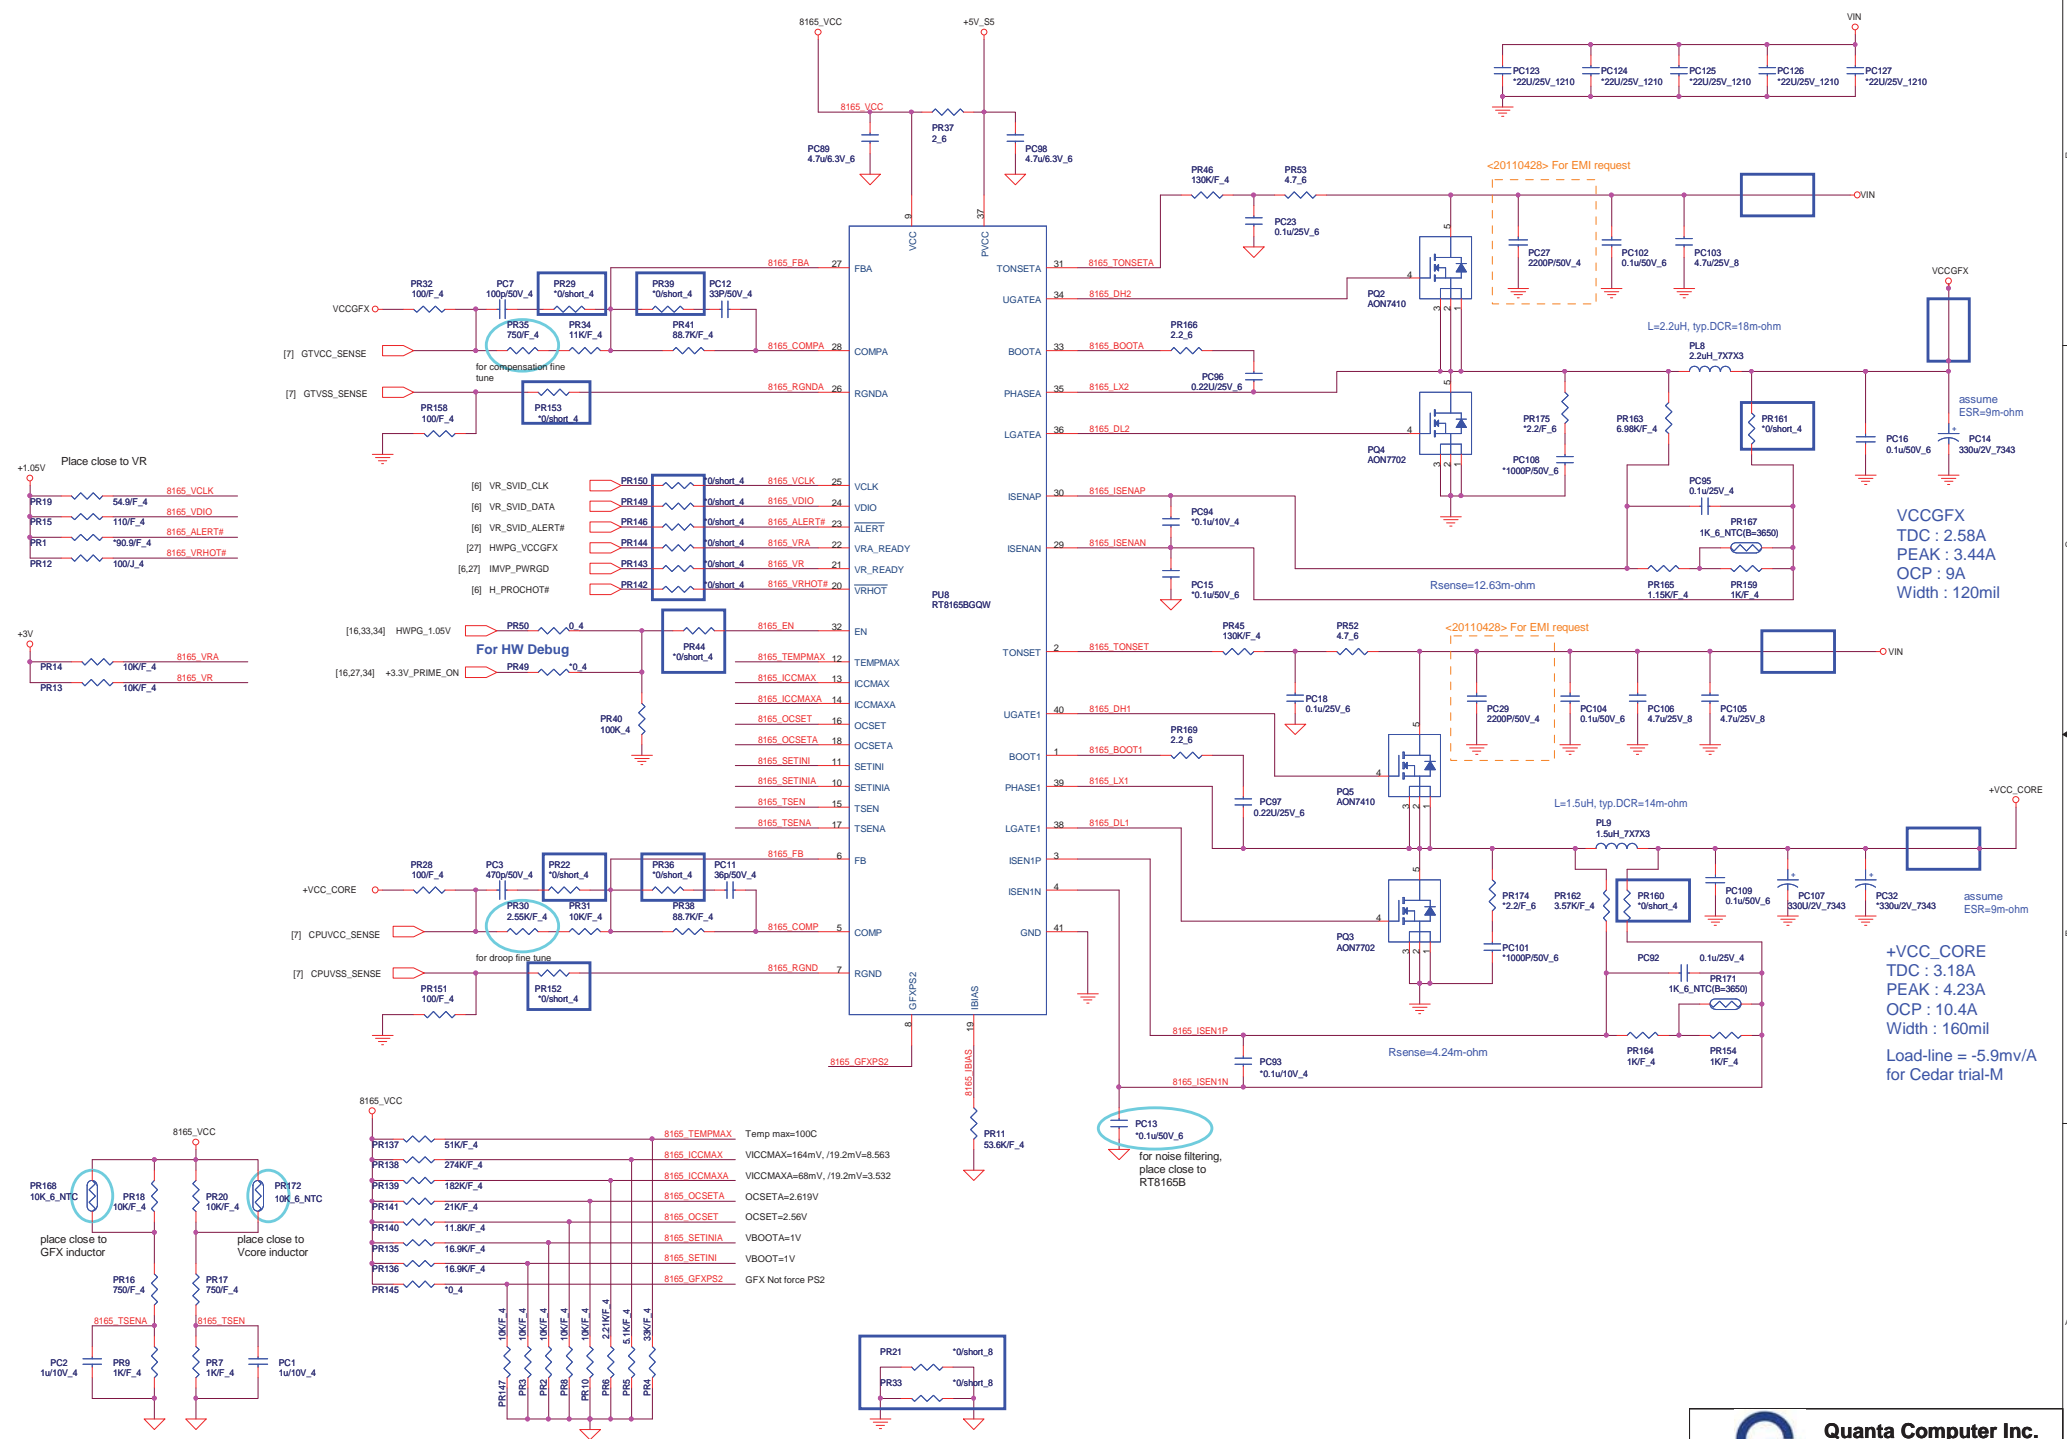


VCCGFX
TDC : 2.58A
PEAK : 3.44A
OCP : 9A
Width : 120mil

+VCC_CORE
TDC : 3.18A
PEAK : 4.23A
OCP : 10.4A
Width : 160mil
Load-line = -5.9mV/A
for Cedar trial-M

[PWM]

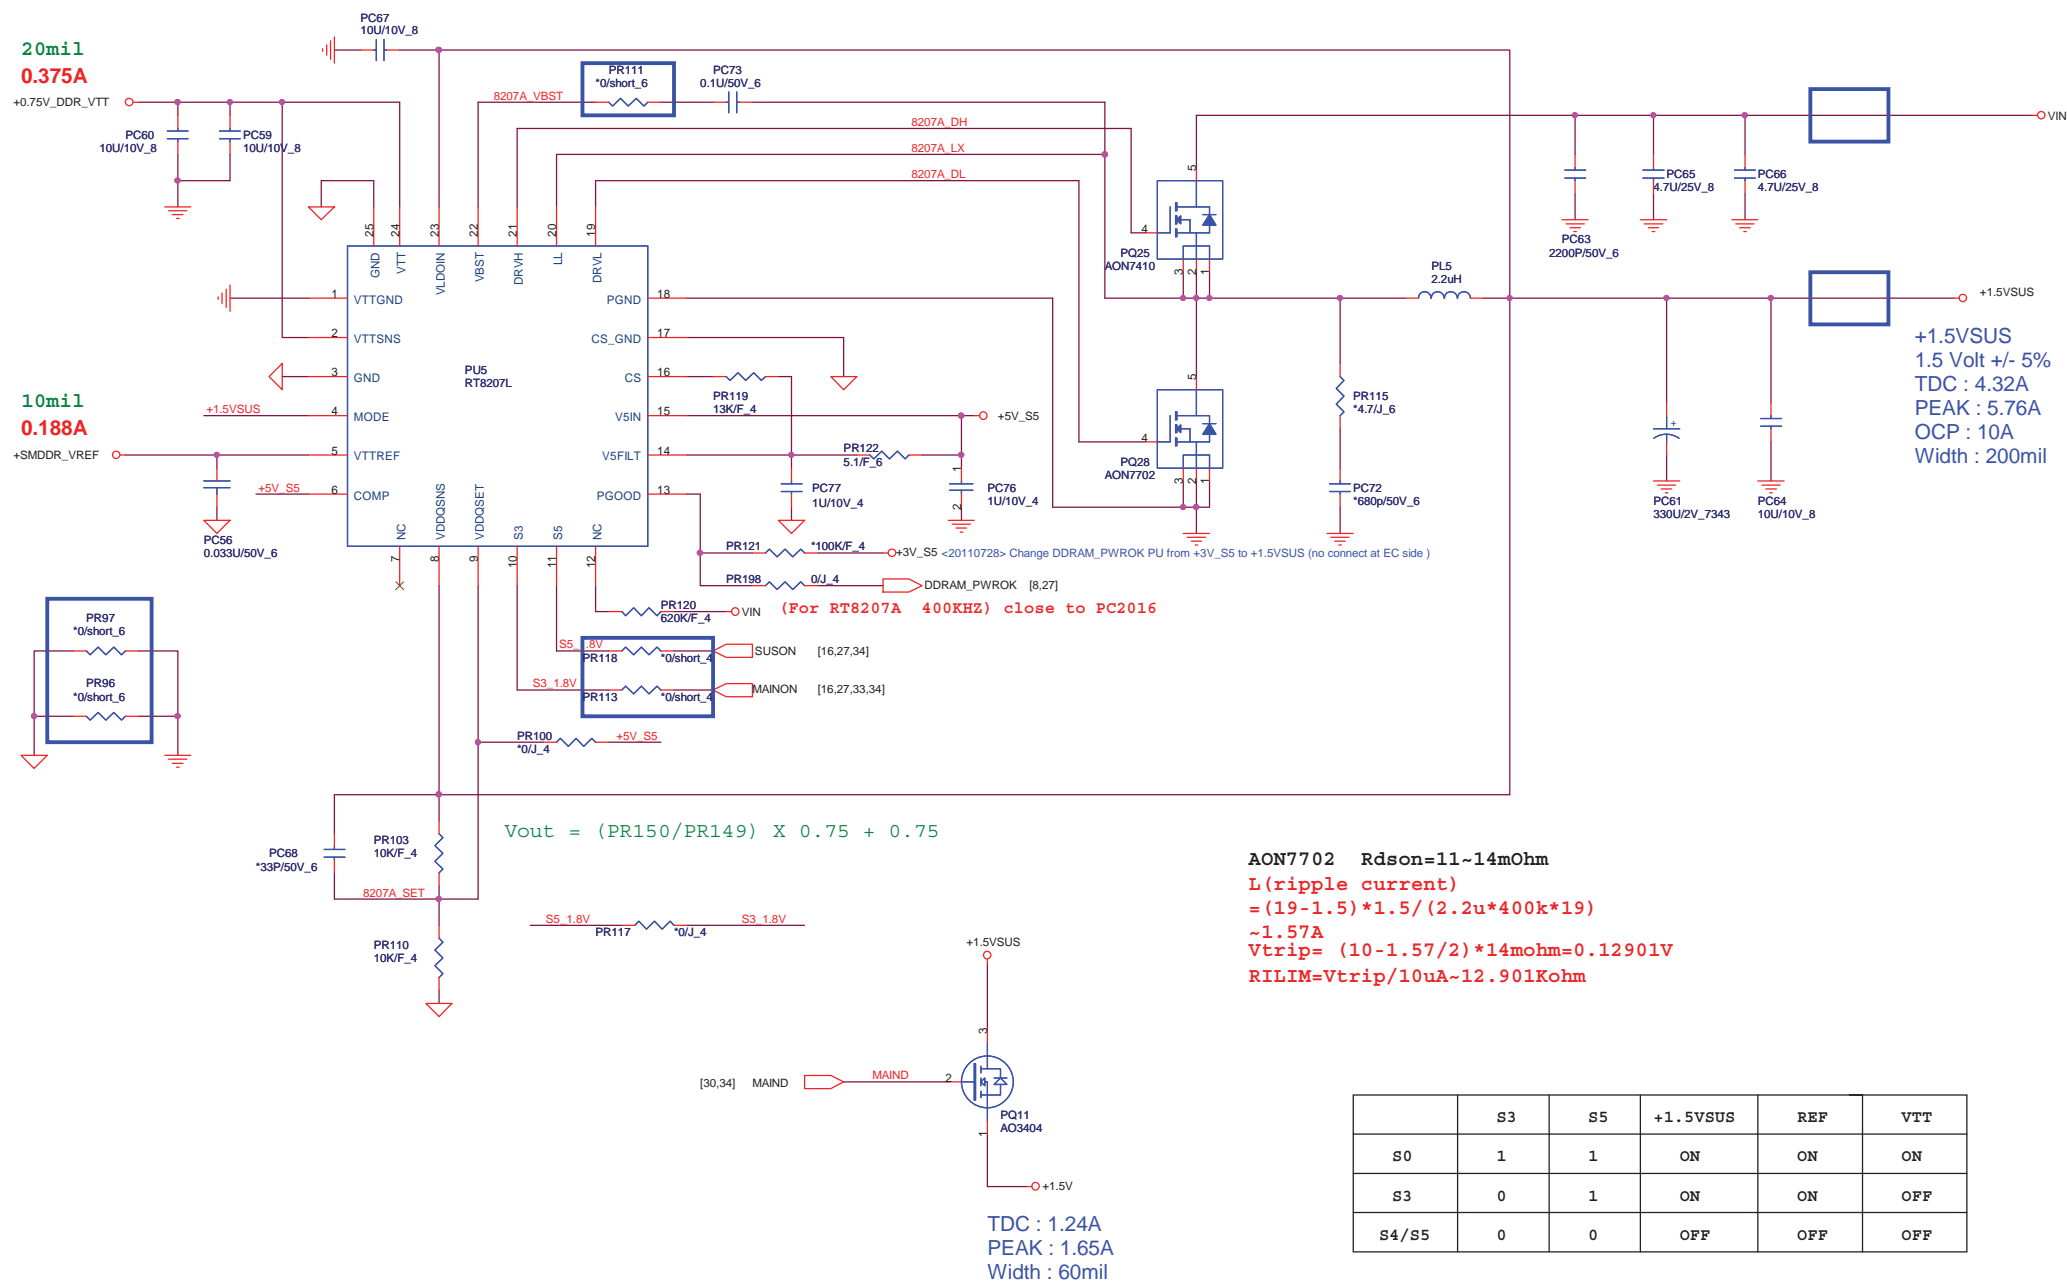

[PWM]

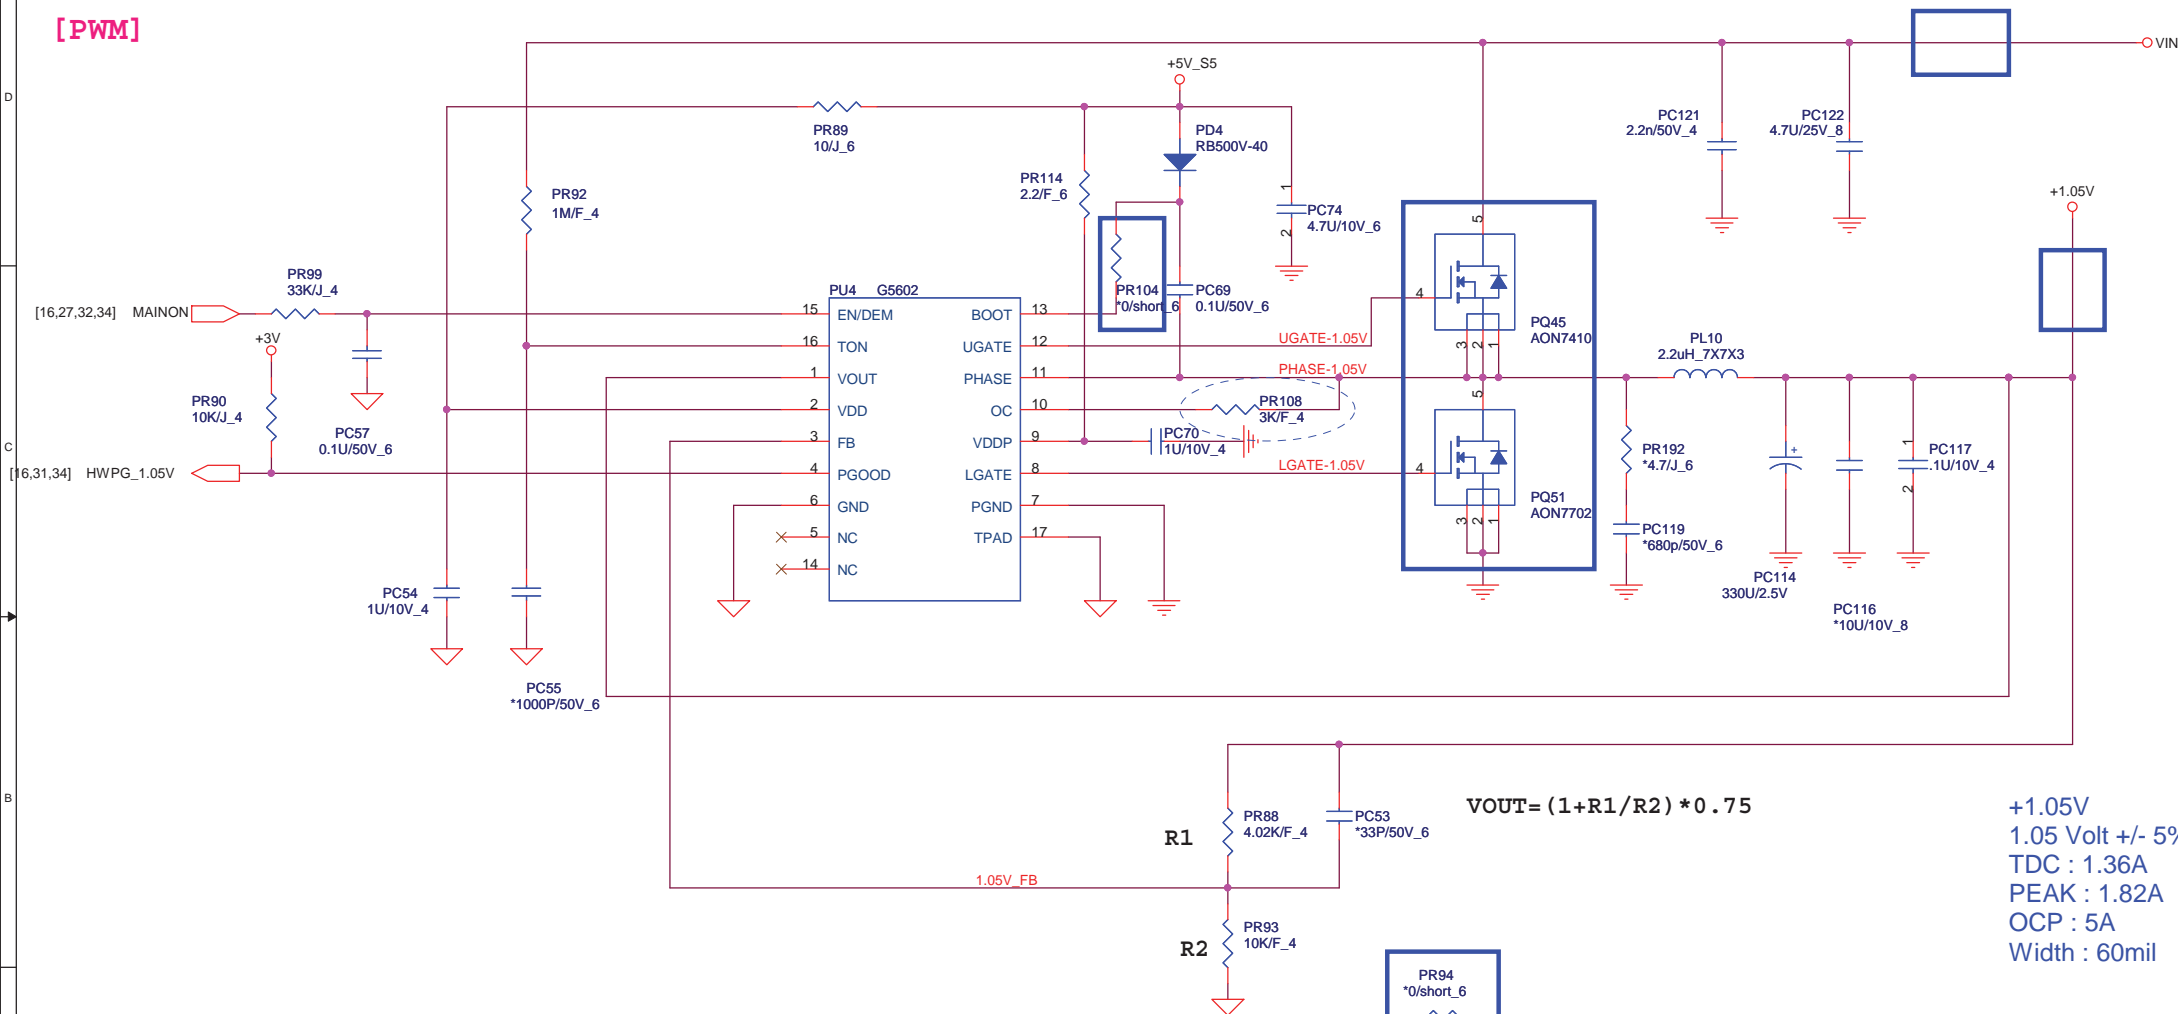

$$TON = 3.85p \cdot R_{TON} \cdot V_{out} / (V_{in} - 0.5)$$

$$Frequency = V_{out} / (V_{in} \cdot TON)$$

$$TON = 3.85p \cdot 1M \cdot 1 / (V_{in} - 0.5)$$

$$Frequency = 1 / (0.0036767) = 272K$$

AON7702 $R_{dson} = 11 \sim 14m\Omega$

$$L(\text{ripple current}) = (19 - 1.05) \cdot 1.05 / (2.2u \cdot 272k \cdot 19) \sim 1.658A$$

$$R_{th} = 14m \cdot (5 - 0.829) / 20uA$$

$$R_{ILIM} = 2.92K\Omega$$

$$V_{OUT} = (1 + R1/R2) \cdot 0.75$$

+1.05V
1.05 Volt +/- 5%
TDC : 1.36A
PEAK : 1.82A
OCP : 5A
Width : 60mil




Quanta Computer Inc.


PROJECT : ZE7

Size	Document Number	Rev
	+1.05V(UP6111AQDD)	C3C


Date: Wednesday, August 31, 2011 Sheet 33 of 42

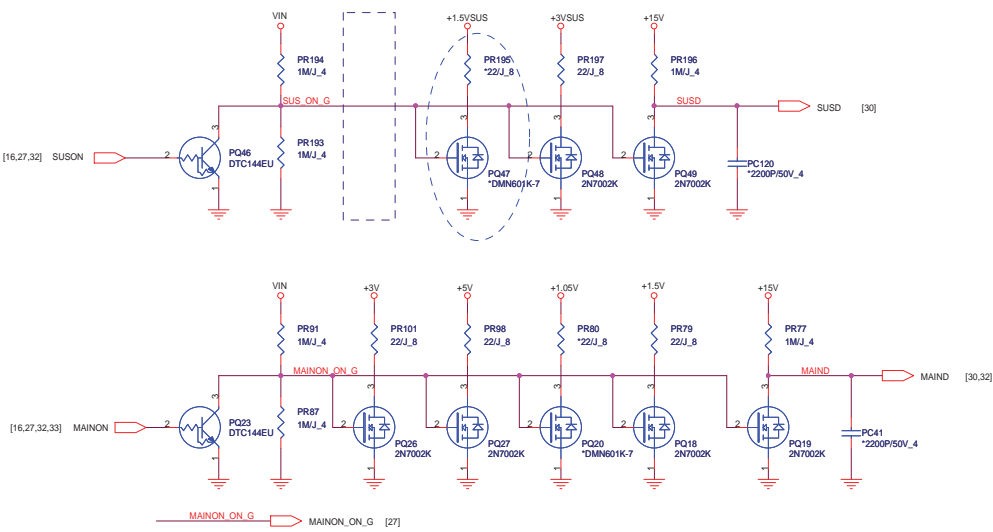

Reserve For VCCGFX

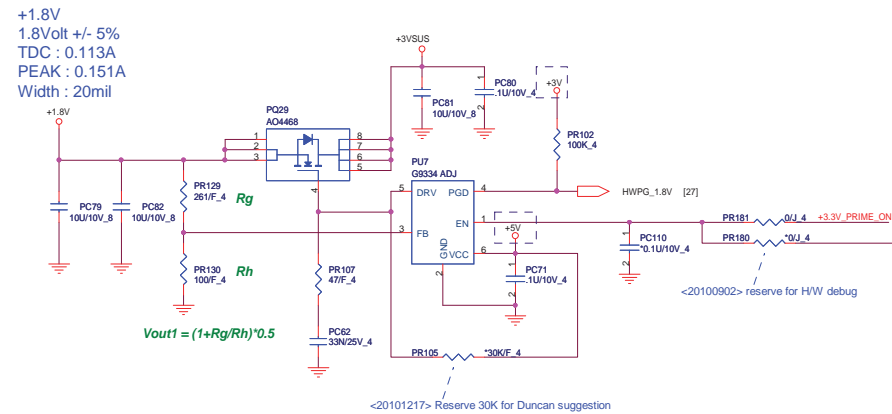


For +3V_PRIME

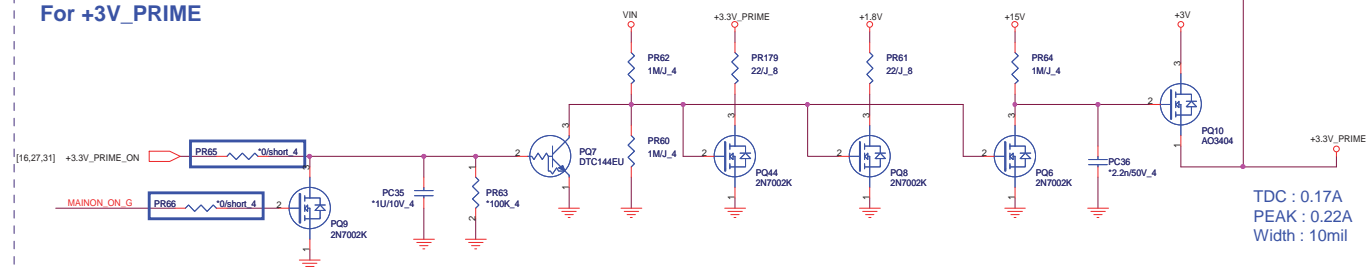

Thermal protection temperature = 60C


<20110421>
Change PR112 from CS21742FB00 to CS22212FB11,
for change M/B from 67°C to 60°C and bottom fin to
88°C thermal protection. (Follow ZE6)

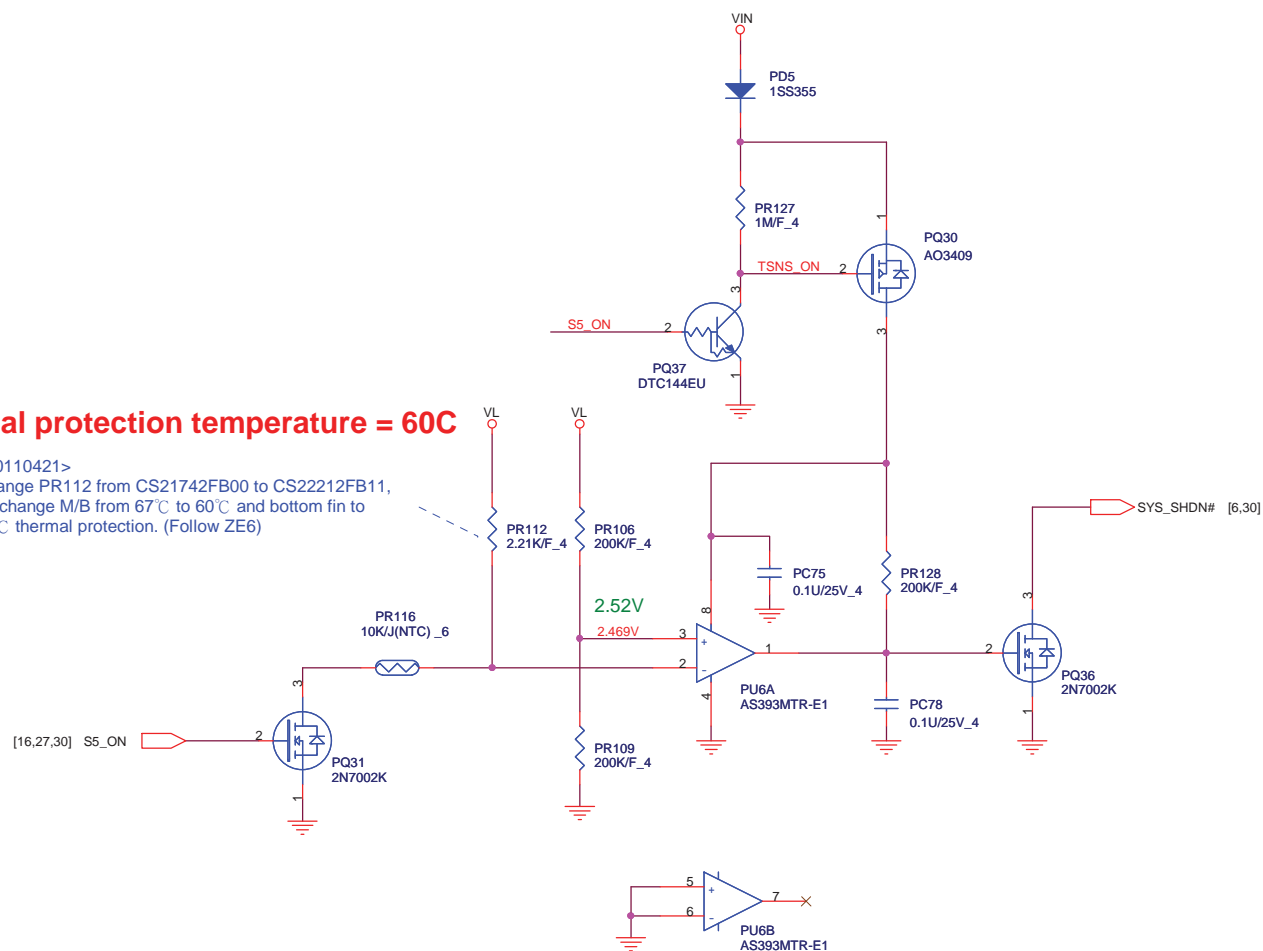



Quanta Computer Inc.

PROJECT : ZE7

Size	Document Number	Rev
	Thermal protect	C3C
Date:	Wednesday, August 31, 2011	Sheet 35 of 42

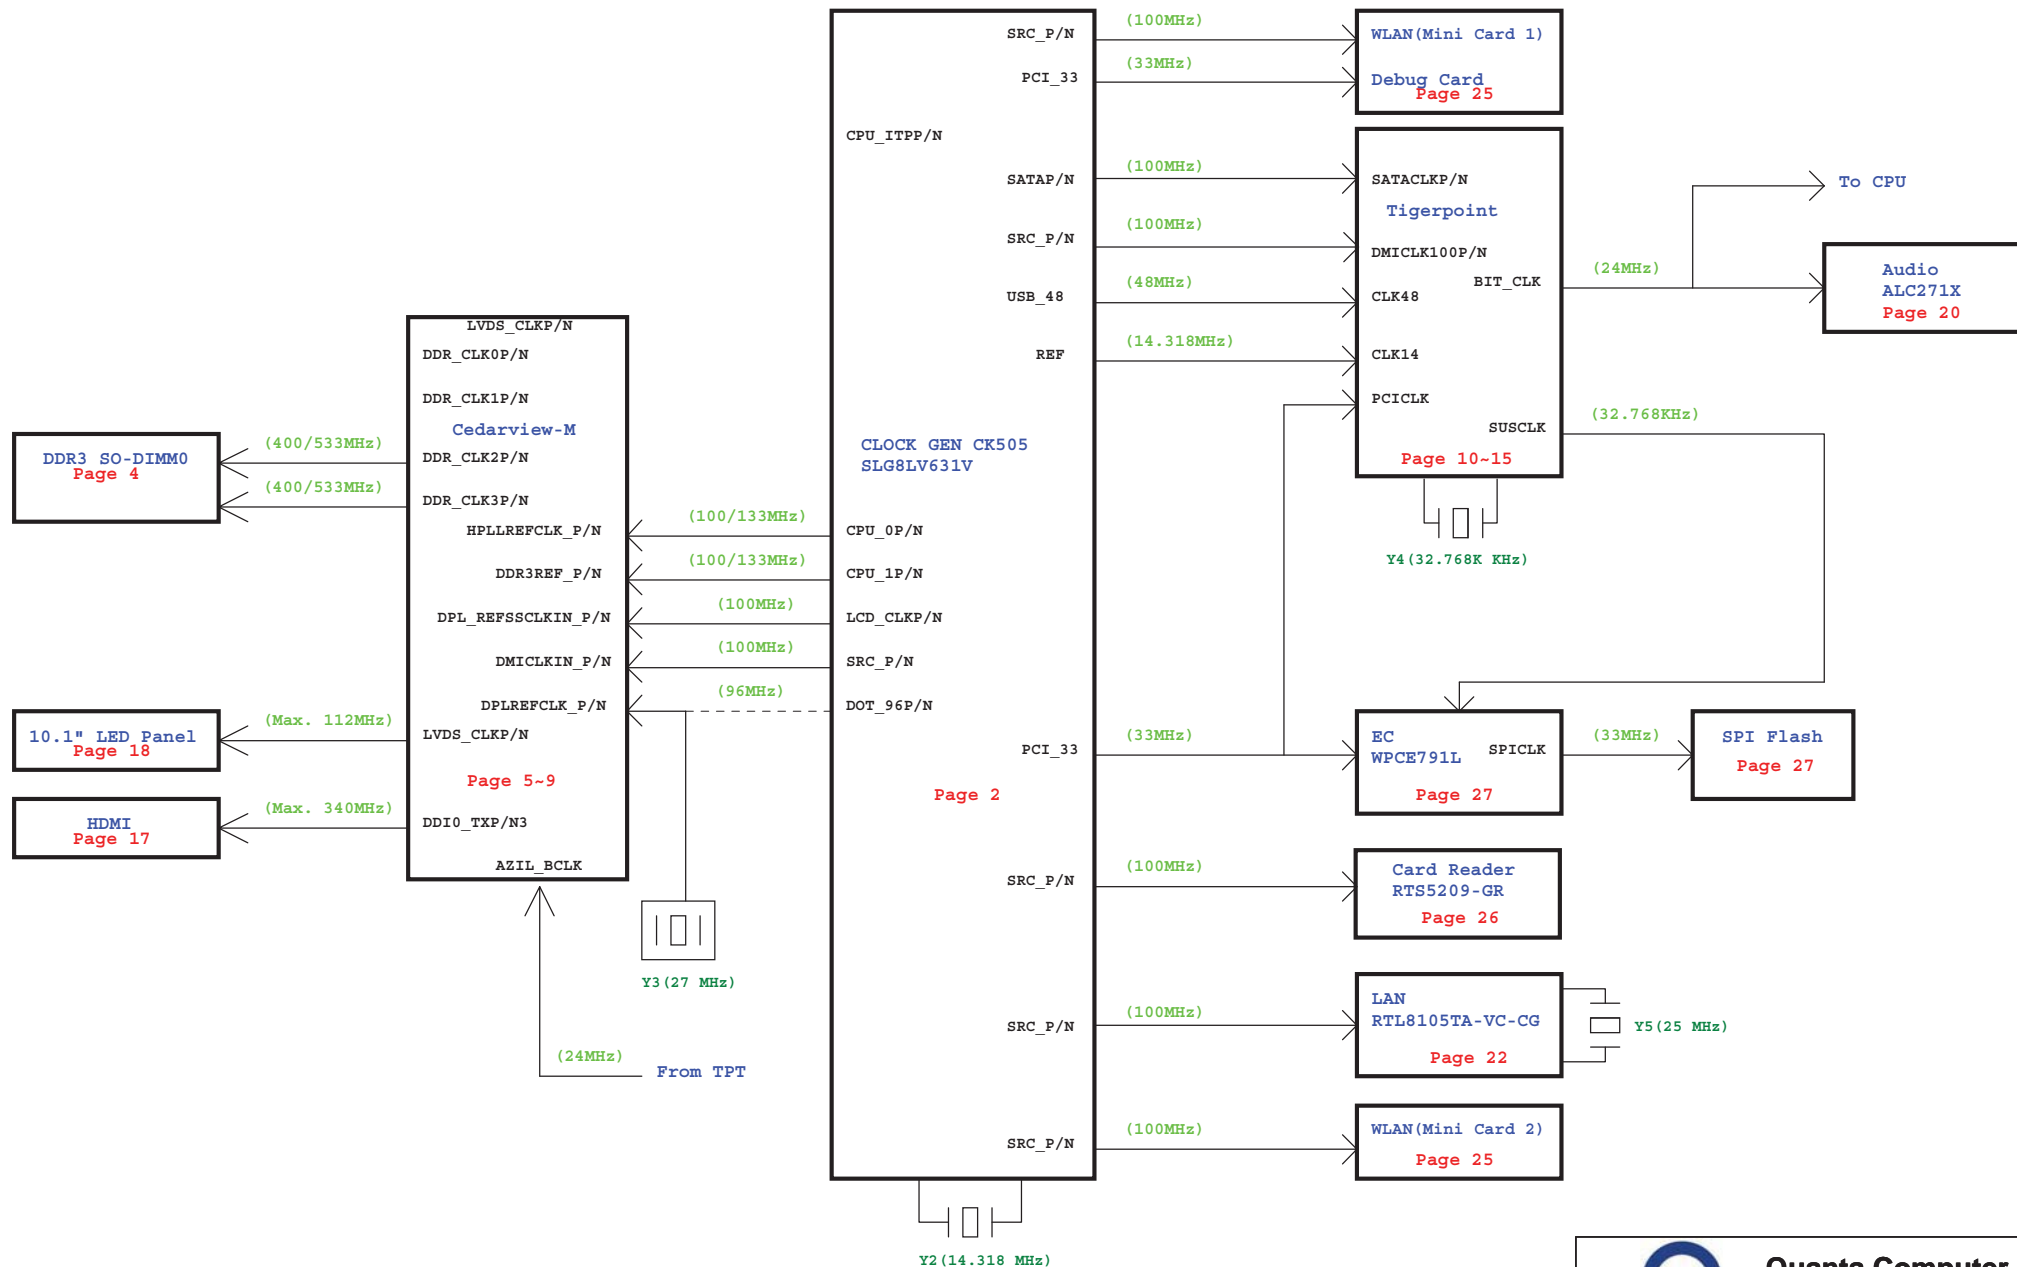

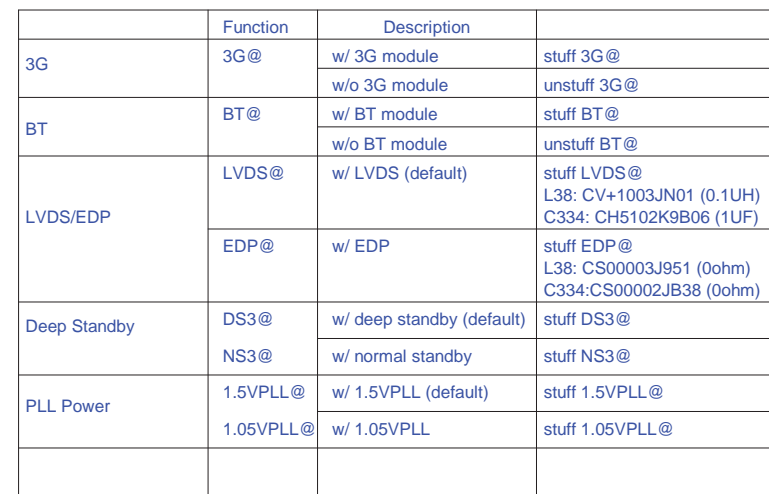

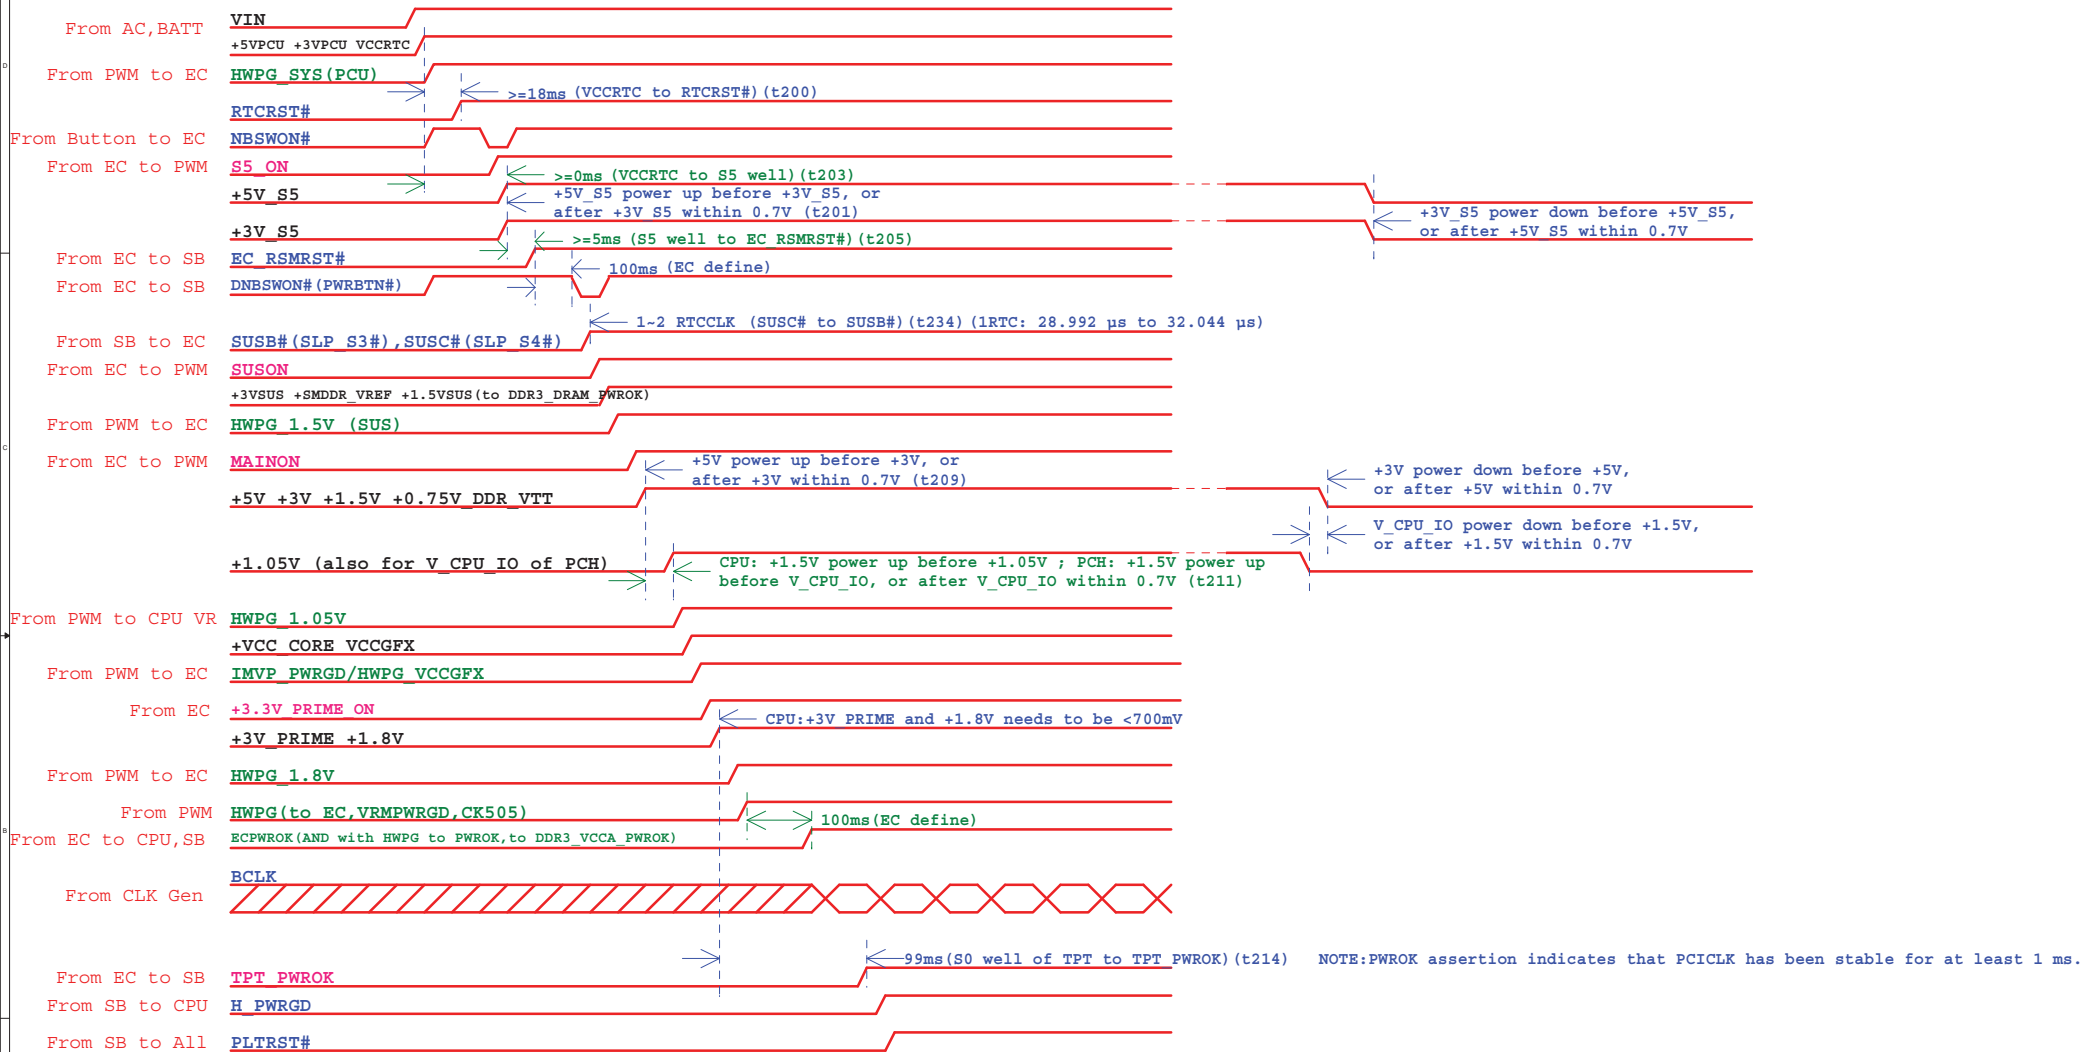

*Note: EC will sampling SUSB# & SUSC# every 5ms.

ICH SMBUS Table

	CLK GEN	RAM	*Mini Card (WLAN)	*XDP	
(SMB_DATA)/(SMB_CLK) (+3V_S5)	V	V	V	V	
Power Plane	+3V	+3V	+3V	+3V	
MOS CKT (Level shift)	Stuff	Stuff	Stuff	Stuff	


*=Reserve


EC SMBUS Table

	Battery	CPU Thermal Sensor	GFX Thermal Sensor
EC791 SDA1 / SCL1 (+3VPCU)	V		
EC791 SDA2 / SCL2			
EC791 SDA3 / SCL3			
Power Plane	+3VPCU		
MOS CKT (Level shift)	X		

SLP_S3#(SUSB#):
S3 Sleep Power plane control Assertion of SLP_S3# shuts off power to non-critical components when system transitions to S3, S4, or S5 states.

SLP_S4#(SUSC#):
S4 Sleep Power plane control - Assertion of SLP_S4# shuts power off to non-critical components when system transitions to S4 or S5 state.

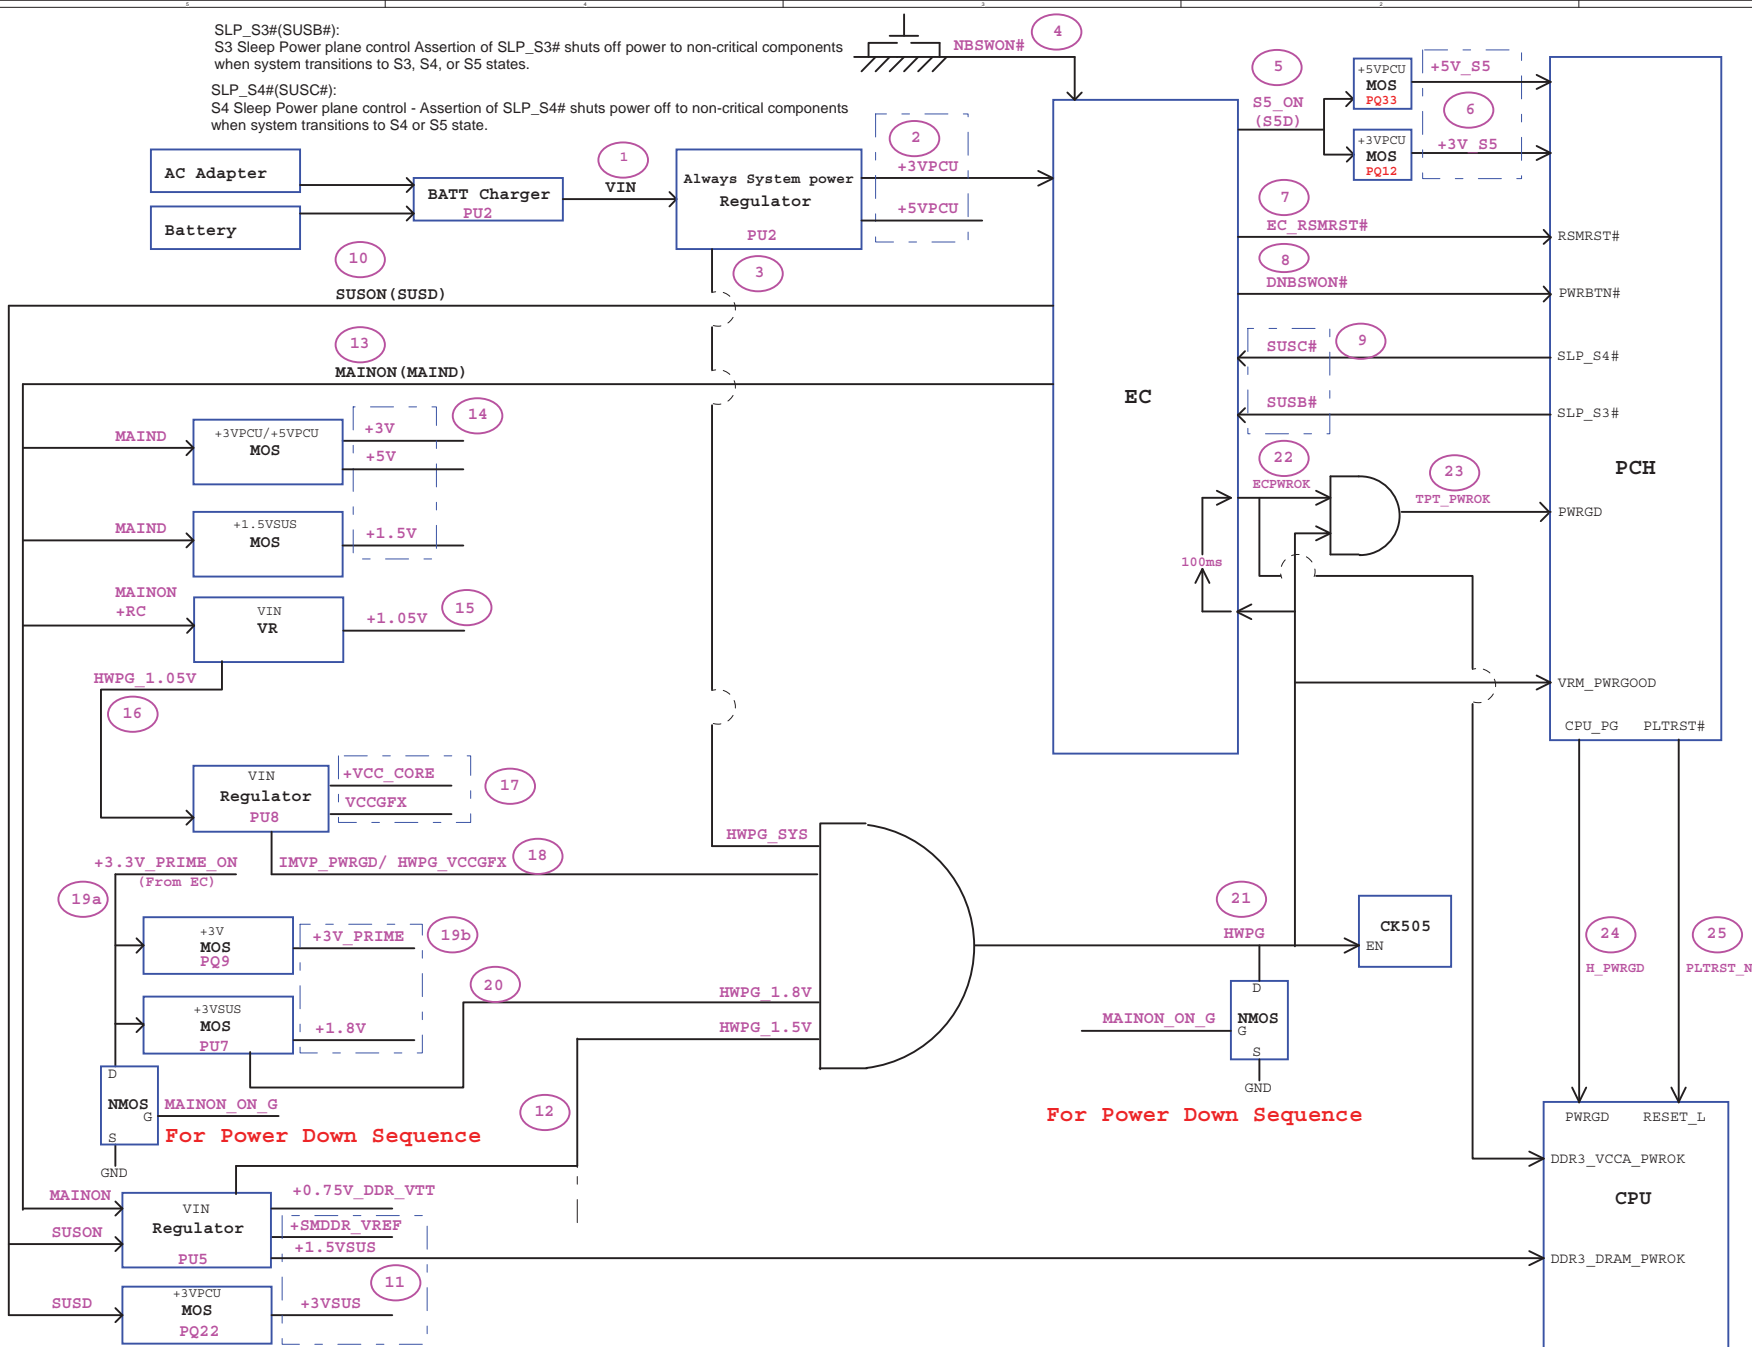

Model		REV	CHANGE LIST			MODEL	ZE7	
							FROM	To
							C1A	D1A
							D1A	E1A
ZE7 MB	D1A	20101124:	<Page 27> Del net USB_EN#_1 / USB_EN#_2 / USB0C#R2 / USB0C#R1 / 5VUSB_3 <Page 27> Add USB_EN# / USB0C#R <Page 10> Del USB0C0# / USB0C3# / USB0C1# ; Add USB0C#R_1 / USB0C#L_1 <Page 26> Add net SD_D2_R					
		20101125:	<Page 26> Del net MS_CLK_R / PCIE_CLK_REQ1# <Page 26> Delete R628; Reserve C510 for EMI (follow vendor CRB)					
		20101126:	<Page 5> Add net name TX1_HDMI+ / TX1_HDMI- / TX2_HDMI+ / TX2_HDMI- / TX3_HDMI+ / TX3_HDMI- <Page 5> Add net name TXL0UT0_R+_EDPTX1+ / TXL0UT0_R-_EDPTX1- / TXLCLKOUT+_R_EDPTX2+ / TXLCLKOUT-_R_EDPTX2- <Page 5> Add net name LCD_CLK_R_EDPTX3+ / LCD_DATA_R_EDPTX3-					
		20101129:	<Page 27> Change UI4 from AKE38FP0N01 to AKE38ZP0N02 for EC request <Page 20> Modify Headphone Jack schematic to follow ZE6 <Page 24> Add LED5 for power indicator					
		20101130:	<Page 16> Delete SIO board connector <Page 5> Stuff C432 to follow checklist0.7 <Page 7> Stuff C422; Unstuff C210/C111; Change C408 to 22U/6.3V_8/ C409 to 1U/6.3V_4 to follow checklist0.7					
		20101206:	<Page 26> Change card reader connector P/N footprint due to ME request <Page 29> Update battery connector to follow ZE6					
		20101209:	<Page 17> Change HDMI connector to DFHS19FR015 by PDC suggestion					
		20101213:	<Page 31> Delete PC120 at +VCC_CORE (Power team Duncan will use A3 M/B to verify again) <Page 18> Reserve L21/ L22 /L40 /L41/ R253/ R255/ R258/ R259/ R262/ R263/ R265/ R269 for LVDS signals (RF suggestion)					
		20101216:	<Page31> Reserve PC53/PC120 for EMI suggestion <Page12> Reserve R356/ C290 for EMI suggestion					
		20101217:	<Page20> Change CN10(internal speaker CONN) from DFHD04MR981 to DFHD04MRA75 (follow ZE6) <Page28> Add NUT part number (follow ZE6)					
		20101220:	<Page5> Swap DDI0_TX2_DP /DDI0_TX0_DP ; Swap DDI0_TX2_DN /DDI0_TX0_DN to correct HDMI channel <Page22> Change RJ45 connector to DFTJ12FR221 to follow ZE6					
		20101221:	<Page13> Change RTC battery from pin type to holder(DFHS02FS561)					
		20101228:	<Page29-35> Update power budget description <Page1-40> Update test pad size to TP2650 <Page29> Update battery connector P/N to DFAD08MR013 (follow ZE6)					
		20101229:	<Page24> Unstuff HDD LED related circuit for cost down requirement <Page31> Change PR71 to 5.72K_F cause VCCGFX power-budget has changed to 2.58A (Power budget V0.3) <Page20> Modify speaker connector pin definition to follow PDC design					
		20101231:	<Page20> Modify earphone and mic connector pin definition					
		20110103:	<Page22> Modify CLKREQ_LAN#_R to CLKREQ_LAN#_R1 because netname duplicate					
		20110104:	<Page13> Change EC_SMI# to GPIO10; Delete net PCH_GPIO10; Add net PCH_GPIO8 <Page20> Modify speaker connector pin definition back to original design <Page19> Modify TP connector pin define to correct TP doesn't work issue --Gerber out for A4-test--					
	E1A	20110105:	<Page 25> Add net WLAN_LED1#					
		20110106:	<Page 7> Change L8/ L12/ L13 from CV01001MN16 to CV01001MN08 for shortage issue					
		20110107:	<Page 5> Add NCT7717U thermal sensor circuit (Reserve)					
		20110110:	<Page 2> Add R515/ R516 for USB 48M CFG input hardware strapping to allocate PLL assignment. (Reserve) <Page 10> Exchange USB port1 with port3 for S3 auto resume issue					
		20110111:	<Page 21> Add USBP3+_L1/ USBP3+_L1/ USBP3+_L2/ USBP3+_L2/ USBP3+_L/ USBP3+_L/ CHARGE_IC_ON for USB charger reserve <Page 20> Add net AMIC2_INT; Delete net LIN2_INT R/ LIN2_INT L for A-MIC (follow ZE6)					
		20110113:	<Page 27> Add DNBSWON#_1 and D41 to solve +3V_S5 current leakage					
		20110117:	<Page 20> Reverse CN4 connector routing for A-MIC cable design (follow ZE6)					
		20110119:	<Page 2> Change R515 from 10K ohm to 20K ohm for vendor's suggestion. (Reserve)					
		20110124:	<Page 25> Change net name from CLKREQ_MMCM# to CLKREQ_3G# <Page 25> Change R257 from 10K to 100K to solve leakage (follow ZE6)					
		20110127:	<Page 18> Delete netname VCC_DDC					
		20110214:	<Page 19> Change CP1-CP6 footprint from 8p4r-0402-smt to 8P4R for SMT open issue					
		20110221:	<Page 2> Reserve 0.1F cap to solve that PCICLK (EC 33MHz) sometimes will change to 25MHz after flash BIOS and restart in first time issue. <Page 2> Exchange PCLK_DEBUG and LCLK_EC for PCICLK issue.					
		20110224:	<Page 18> Change C300 from 2.2U to 10U to solve LCDVCC fall time issue. <Page 18> Add net +5V_LCD for IVO panel using <Page 20> Reserve DMIC signals to co-layout with DMIC connector, reserve R526/ R527 add net AMICINT_DMICDAT / AMICGND_DMICCLK <Page 10> Unstuff C111/ C123/ C125/ C133/ R78/ R79/ R84/ R86 to change DMI from x4 to x2					
		20110301:	<Page 07> Change C326 from 10U to 47U; Add C386 47U for CRT flickr issue. <Page 18> Change L15/ L16/ L17 from 47ohm to 22ohm; Remove C109/ C110/ C114 for CRT issue <Page 18> Change C79/ C80/ C81 from 22pF to 4.7pF for CRT issue.					
		20110302:	<Page 35> Reserve PR129 for no use					
		20110303:	<Page 5> Reserve DDI1_PU resistors R529 to follow CRB(eDP); Add net DDI1_DDC_SCL/ DDI1_DDC_SDA <Page 20> Reserve L42/ L43/ L44/ L45 for ESD solution					
		20110304:	<Page 20> Change R525 from 0603 short pad to 0603 0ohm <Page 25> Unstuff PD8/ PR106/ PR133 for no use <Page 5> Stuff R512/ R513/ U26/ C381/ C382/ R514/ R509/ C384/ C383 for thermal sensor <Page 27> Stuff R175/ R160 for thermal sensor <Page 24> Unstuff C320 for cost down					
		20110307:	<Page 18> Reserve R530 for eDP function hardware short term solution					
		20110308:	<Page 23> Reserve stitching cap for RF suggestion <Page 24> Unstuff C320 for cost down <Page 35> Delete PR106/ PR113/ PD8/ PR129 (thermal protection) for unused circuit (follow ZYG) <Page 28> Change Hole16/ Hole17 footprint to h-tcl77bc295d120p2 <Page 5> Delete R510/ R511 for thermal sensor SMBUS_PU (PU at EC side) <Page 5> Unstuff C384/ C383; Change C382 from 10U_8 to 4.7U_6 <Page 6> Reserve R531 for thermal sensor test					
DOC NO.	PROJECT MODEL :	ZE7	APPROVED BY:	DATE:		<div> Quanta Computer Inc. PROJECT : ZE7</div> <div><small>Size: Document Number</small> Change List1 <small>Date: Wednesday, August 31, 2011</small></div> <div><small>Rev C30</small></div>		
	PART NUMBER:		DRAWING BY:	REVISION:				

Model	REV		CHANGE LIST	MODEL	ZE7	
					FROM	To
ZE7 MB	E1A	20110308:	<Page 13> Unstuff R451 for using thermal sensor (Need stuff when no use thermal sensor) <Page 27> Change thermal sensor SMBUS PU from +3V_S5 to +3V <Page 28> Change Hole18/ Hole19/ Hole20 footprint to h-c197d63p2 <Page 18> Add R510 for eDP function verifying		C1A	D1A
		20110309:	<Page 28> Add hole23 <Page 20> Change R525 from 0603 short pad to 0402 0ohm --Gerber out for A5-test--		D1A	E1A
	F1A	20110309:	<Page 20> Change R525 from 0603 short pad to 0402 0ohm		E1A	F1A
		20110314:	<Page 27> Change U7(BIOS) to AKE38FP0Z01 (follow ZE6)		F1A	G1A
		20110315:	<Page 20> Change L27 from CS00004JA40 to CX121T30001 <Page 20> Delete R208/ R251/ R433/ R475 for CS00003J951		G1A	A3A
		20110318:	<Page 29> Change DC jack to DFPJ03MR043 (follow ZE6)			
		20110328:	<Page 28> Change Thermal nut to MBZH5002012 (follow ZE6)			
		20110330:	<Page 2> Change R236 PU connect from PM STPCPU# to PM STPCPU#_R			
		20110406:	<Page 24> Change R329 from CS11202JB21(120ohm) to CS05102JB35(51ohm) PWR light <Page 24> ChangeR326/ R323/ R321 from CS12702JB14(270ohm) to CS12002FB25(200ohm) Blue light <Page 24> ChangeR327/ R324/ R322 from CS14702JB28(470ohm) to CS13302FB11(330ohm) Amber light <Page 22> Unstuff R341/ R330 for W/O LED RJ45 CONN (follow ZE6) <Page 27> Del T44 for no use of CIR uart function, will place T34 for ICT programming			
		20110407:	<Page 28> Add GND PAD1 for LED ESD using <Page 16> Unstuff R100/ R142/ R143/ R132/ R96/ R97 for height limit			
		20110412:	Change Q1/ Q27/ Q34/ Q35/ Q39/ Q42/ Q43 from BA0390400H0 to BA039040020 for EOL issue Change PL1/ PL2/ PL6 from CX0R800R014 to CX12T800000 for EOL issue (EMI Sam provide) <Page 18> Change MRI from AL003661003 to AL002618001 for EOL issue (ZE6 2nd source)			
		20110413:	<Page 30> Change PU3 from AL008206002 to AL008206000 <Page 23> Add C388/ C389 stitching caps for monitor flickr issue <Page 11> Add net CPUSLP# / CPUSLP#_R and add R511/ R532 to reserve CPUSLP function			
		20110414:	<Page 22> Change D35 from CY640P31Z08 to CY003100Z06 for cost down <Page 13> Stuff R451 to reserve thermal sensor function <Page 9> Unstuff C381/ C382/ R509/ R512/ R513/ R514/ U26 to reserve thermal sensor function <Page 27> Unstuff R175/ R160 to reserve thermal sensor function <Page4> Modify DDR DQ/ DQS/ DM signals to no swap type			
		20110418:	<Page29-35> Change Power solution for ZE7 project <Page 23> Delete C389 for CRT DAC stitching cap <Page 30> Change JF1007 footprint to RC3720-SMT			
		20110420:	<Page 11> Delete net CPUSLP# / CPUSLP#_R and delete R511/ R532 to remove CPUSLP function (nettop platforms only) <Page 20> Change R178/ R477 from 75ohm to 47ohm for earphone gain fine tune (follow ZE6)			
		20110422:	<Page 18> Change MRI from AL002618001 to AL003661006(PT3661G-BB) for Lid switch issue <Page 30> Delete PC1032 for power request <Page 31> Delete PC1019; Add PR1104; Change PQ1001 (Dual MOS) to PQ1001 & PQ1008 (3X3 QFN) <Page 9> Un-stuff R149/ R151/ R478/ R479 to solve leakage issue <Page 18> Change C138 from 0.1U 6 to 4.7U 8 to solve hall sensor issue			
		20110425:	<Page 25> Change U7 from AKE38FP0Z01 to AKE38FP0N01 for ICT MAC ID issue <Page 18> Change C138/ C318 from 4.7u 8 to 4.7u 6 (CH5471K9E07)			
		20110426:	<Page 13> Add C389 0.1U 4 for TPT PWROK glitch issue <Page 2> Change Y2 from BG614318242 to BG614318F33 for new part			
		20110427:	<Page 26> Change C267/ C268 from 22P/50V 4 to 10P/50V 4 for EMI request <Page 26> Add R511 and net MS_CLK_R for EMI request <Page 26> Change R271/ R285/ R290/ R299/ R305/ R313 from 0ohm to 33ohm for EMI request			
		20110428:	<Page 26> Del R511 and net MS_CLK_R, change R303 from 0ohm to 33ohm for EMI request <Page 13> Reserve C390 30P 4 for EMI request <Page 20> Add C391 1n 4 for amic noise depressing (Realtek Vic suggest) <Page 31> Add PC1019/PC1032 2200p 4 for EMI request <Page 30> Change PC1043/ PC1046 from 330uF to 220uF; Change PL4 from 3.3uH to 2.2uH <Page 30> Change PR1098 from 4.7K ohm to 48.7K ohm			
		20110429:	<Page 13> Stuff R85,R449,R455 for ZE7 A2 stage (Board ID PD) <Page 20> Change R178/ R477 from 47ohm to 56ohm to meet acer Full Scale Output Voltage (FSOV) spec <Page 13> Reserve R511 0ohm and RTCRST#_EC for RTC reset workaround solution <Page 19> Stuff CP1-CP6 for EMI Sam request			
		20110506:	Rename <Page 17> Unstuff R138 to follow CRB			
		20110510:	<Page 18> Change MRI from AL003661006(PT3661G-BB) to AL009132001 (CMOS type) <Page 18> Change C138 from 4.7U 6 to 1U 6; Unstuff R91 because MRI is CMOS type <Page 22> Change C4/C7 from 27P to 33P(CH03306JB04) by vendor fine tune result			
		20110516:	<Page 11> Add R532/ R533 and net CPUSLP#_R / CPUSLP# (enable C6-state) <Page 17> Add R534/ R535 PU 2K for HDMI I2C to follow CRB <Page 24> Del SW4 for no use <Page 5> Change C334/ C335 from 18P 6 to 33P 4 for crystal vendor's report <Page 18> Add R536/ D44 for MRI EOS protection <Page 10> Modify USB0C pin <Page 13> Change CN5 to DPHS02FS032 for SMT issue <Page 13> Change R93/ R454/ R472/ R468 from CS03302JB29 to CS09092FB15 (RES CHIP 90.9 1/16W +-1%(0402)) to follow CRBv1.5 Remove Deeper Standby/ XDP/ DMIC/ USB charger function			
		20110520:	<Page 8> Change R99 from 12.1K to 121ohm to follow CRBv1.5 <Page 8> Change R98 from 10K to 100ohm to follow CRBv1.5			
		20110525:	<Page 30> Modify JP9 footprint to RC3720-SMT for SMT open issue			
		20110530:	<Page 24> Modify LED4 from +3V to +5V Due to there is the internal series resister in 3G/WLAN module, cause the forward voltage of LED4 is too small			
		20110531:	<Page 29-35> Update power portion			
		20110601:	<Page 26> Modify CN20 (Card reader CONN) footprint to 7in1-cm7r-052-h-d-44p-smt by SMT ME Peter request <Page 23> Change C140 from 0402 to 0603; Del C141 <Page 29> Change PU9001 to PU2; Change PU2 footprint from QFN28-5X5-5-33P to QFN28-5X5-5-33P-SMT <Page 31> Add Power Jumper for power consumption measurement			

Model	REV	CHANGE LIST	MODEL	ZE7	
				FROM	To
ZE7 MB		20110602: <Page 7> Del R490 and short for VCCCKDDR_VSM		C1A	D1A
		20110603: <Page 23> Del C215 for no use(DMIC stitching cap for RF)		D1A	E1A
		20110607: <Page 2> Delete R287/ R288/ T28 /T29 since SIO board was canceled <Page 2> Delete R238/R239/ CLK_PCIE_MNC_XDP_N/ CLK_PCIE_MNC_XDP_P and short directly since XDP was canceled <Page 25> Un-stuff R314,R294 since all of WLAN modules don't use SMBUS <Page 21> Change USB CHARGE_ON to USB_EN#, delete R524/ USB_BC_EN and short , change U25 to AL000547005 since charge IC was canceled <Page 31> Add PC123(100u/25V_6X5.8) to suppress VIN noise <Page 11> Stuff R105 1K for IOWME to follow CRB design <Page 13> Del R396/ R387, stuff R407/ R382 for PCH_GPIO12/ PCH_GPIO13 (PU for no use) <Page 4> Unstuff C200 /C190 for +0.75V_DDR_VTT <Page 4> Unstuff C203 for +1.5VSUS <Page 7> Change R31/ R45/ R32 from 10uF_8 to 4.7uF_6 <Page 7> Change C362 from 22uF_8 to 10uF_8		E1A	F1A
		20110608: <Page 27> Reserve D22. stuff R281 for +3V_EC; Change D22 from BC000316Z07 to BCRB500VZ29 <Page 31> Add PC123-PC127 to supress Vin noise <Page 27> Reserve D13/D14/ D17/D21 for HMPG		F1A	G1A
		20110609: <Page 25> Un-stuff C9 since EM820W doesn't use Vpp <Page 13> Change Y4 from BG332768A01(20PPM/12.5PF) to BG332768542(20PPM/7PF), and change C348,C349 from 15pF_4 to 6pF_4 Change D8,D10,D19,D23,D24,D25,D39,D41 from BC000316Z07 to BCRB500VZ29		G1A	A3A
		20110610: <Page 24> Change R330/ R327/ R325 to 51ohm_4 for Blue LED; Change R331 to 220ohm_4; Change R328 to 270ohm_4 for Orange LED --Gerber out for C-test--		A3A	B3B
B3B		20110614: <Page 6> Stuff R33 PU 1k ohm(CS21002JB34) to +3V for DBR# by Intel Nick confirming <Page 31> Change PR138 from CS41602FB00 to CS42742FB00 by Duncan request			
		20110622: <Page 24> Change R330 from CS05102JB35(51ohm) to CS03302JB29(33ohm) to meet LED brightness spec. <Page 24> Change R327 from CS05102JB35(51ohm) to CS03302JB29(33ohm) to meet LED brightness spec. <Page 24> Add R328 for CS12202FB14(220ohm) to meet LED brightness spec. <Page 24> Change R325 from CS05102JB35(51ohm) to CS11502FB1(150ohm) to meet LED brightness spec. <Page 24> Change R326 from CS13302FB11(330ohm) to CS14702JB28(470ohm) to meet LED brightness spec.			
		20110627: Change 0ohm resistors to short PAD			
		20110628: Remove common choke footprint Remove power short jumper <Page 2> Unstuff R229 CS00002JB38 for CPU_STOP# to follow checklist rev1.5 <Page 5> Remove R411 / R412 CS00002JB38 and short for CRT_HSYNC / CRT_VSYNC <Page 13> Stuff R513 CS00002JB38 (0/J_4) for RTCSRTH_EC ; Stuff R417 for PLT_RST# <Page 18> Stuff R26 CS00003J951 (0/J_6) for +5V_LCD (IVO panel) <Page 20> Stuff R203/R444 CS00003J951 (0/J_6) for audio ESD solution			
		20110630: <Page 20> Change CN15/CN13(Audio Jack CONN) footprint from phjk-2sj2326-002111-6p to phjk-2sj2326-002111-6p-smt for SMT open issue Change PR65/PR66/PR39/PR29/PR153/PR22/PR36/PR152/PR160/PR161 footprint from RC0402 to short0402 by power Duncan request <Page 31> Stuff PC7 CH14706KB18 (470p_4) for GFX issue <Page 10> Un-stuff C346/ C347 for no support PCI-E in 3G card <Page 18> Remove C324 for LCDVCC power <Page 20> Change C230,C221,C234,C247,C263,C265 from CH6101M9905 (10uF_6) to CH5471M9907 (4.7uF_6) for Audio power <Page 5> Un-stuff R62 to reserve eDP function Unstuff C69; Change C20/CL37/CL57/C298/C310/C309/C387 from (10uF_8) to CH5472K9A02 (4.7uF_8) <Page 5> Change R38/R39 from 4.7K to 2.2K for EDID(follow CRB). <Page 29> Unstuff FUI (battery connector ESD solution)			
Ramp		20110705: <Page 25> Swap USBP7+/USBP7- to correct Wimax function. <Page 20> Stuff BC040201Z00 (TVS/6pF_4) at D9 for analog mic ESD solution			
		20110707: <Page 8> Stuff CS41002JB20(100K_4) at R474 for DDR3_DRAMRST#_R by Intel Nick confirming by Richtek's feedback			
		20110708: <Page 31> Change PC7 from CH14706KB18(470p/50V_4) to CH13306JB14(330p/50V_4) for GFX compensation.			
		20110711: <Page 18> Change R536 from CS00003J951(0_6) to CS04703F912(47_6) to increase hall IC ESD protection level 20110719: <Page 20> Change R172/R497 from CS05602JB17(56_4) to CS04702FB16(47_4) for FAE Vic suggestion to meet acer FSOV spec 20110721: <Page 21> Change U23/U25 footprint from MSOP8-4_9-65-9p to MSOP8-4_9-65 to cancel GND pad for SMT open issue 20110725: <Page 8> Add CH4103K1B08(0.1U/16V_4) cap footprint at C159 for Elpida DDR 2A issue debugging (to suppress glitch)			
		20110727: <Page 8> Reserve 1U/10V_6 cap footprint at C388 for DDRAM_PWROK RC delay <Page 32> Un-stuff PR121 CS41002FB28(100K/F_4) PU for DDRAM_PWROK because D14 is un-stuff at EC side <Page 32> Del netname HWPG 1.5V and change to DDRAM_PWROK			
		20110804: <Page 20> Change L25 from CX1213J001 (120ohm based) to CS00004JA40 (0_8) by EMI confirmed <Page19> Un-stuff CA122084N98 at CP1 - CP6 by EMI confirmed <Page26> Reserve C282/C284/C291/C296/C392/C393 CH01006JB08 (10p_4) by EMI confirmed			
		20110805: <Page 20> Reserve R520 0_6 footprint for analog mic ESD protection <Page 20> Stuff R501 0_6 for analog mic ESD protection			
		20110811: Change PC7 from 330p_4 (CH13306JB14) to 100p_4 (CH11006JB00) for power GFX issue			
		20110819: <Page 18> Change R75/R76 from CS01802JB13(18/J_4) to CS04702FB16(47/F_4) <Page 18> Change L16/L17 from CX8BA220007(0.5A/22ohm_6) to CS00003J951(0/J_6)			
		20110830: <Page 8> Change R537/R539 from CS00002JB38(0_4) resistors back to 0402 short pad for Elpida DDR 2A issue debugging			
		20110831: <Page 26> Connect CN20(Card reader CONN) pin27 to GND by EMI Sam suggestion <Page 20> Add R520 CS00003J951(0_6) for analog mic ESD protection <Page 28> Modify Hole1 footprint from hg-c276do94x106p2 to ZE7-P3 for power button ESD solution <Page 28> Modify Hole15 footprint from HG-C276D98P2 to ZE7-P1 for touch pad ESD solution <Page 28> Modify Hole16 footprint from HG-C276D98P2 to ZE7-P2 for touch pad ESD solution <Page 28> Add GND PAD2 for touch pad ESD solution			